

WELL LOG AND DRILLING REPORT

PLEASE USE PENCIL
OR TYPEWRITER.
DO NOT USE INK.

State of Ohio
DEPARTMENT OF NATURAL RESOURCES
Division of Water
1562 W. First Avenue
Columbus, Ohio

No. 245981

County Lucas Township Luria Section of Township _____
Owner John Donley Address 607 Thelma, Luria
Location of property Route 35 East of Luria

CONSTRUCTION DETAILS

Casing diameter 5 5/8" Length of casing 63 ft
Type of screen _____ Length of screen _____
Type of pump Jch
Capacity of pump 8 GPM
Depth of pump setting 60 ft
Date of completion May 24 - 62

BAILING OR PUMPING TEST


Pumping rate 7 G.P.M. Duration of test 24 hrs.
Drawdown 5 ft. Date May 20
Developed capacity 20 GPM
Static level—depth to water 33 ft.
Pump installed by Paul Bellamy

WELL LOG

Formations Sandstone, shale, limestone, gravel and clay	From	To
Top soil	0 Feet	<u>2</u> Ft.
yellow clay	<u>2</u>	<u>15</u>
Blue "	<u>15</u>	<u>50</u>
yell sandy Clay	<u>50</u>	<u>60</u>
Coarse sand	<u>60</u>	<u>63</u>
Gravel & Water		

SKETCH SHOWING LOCATION

Locate in reference to numbered
State Highways, St. Intersections, County roads, etc.

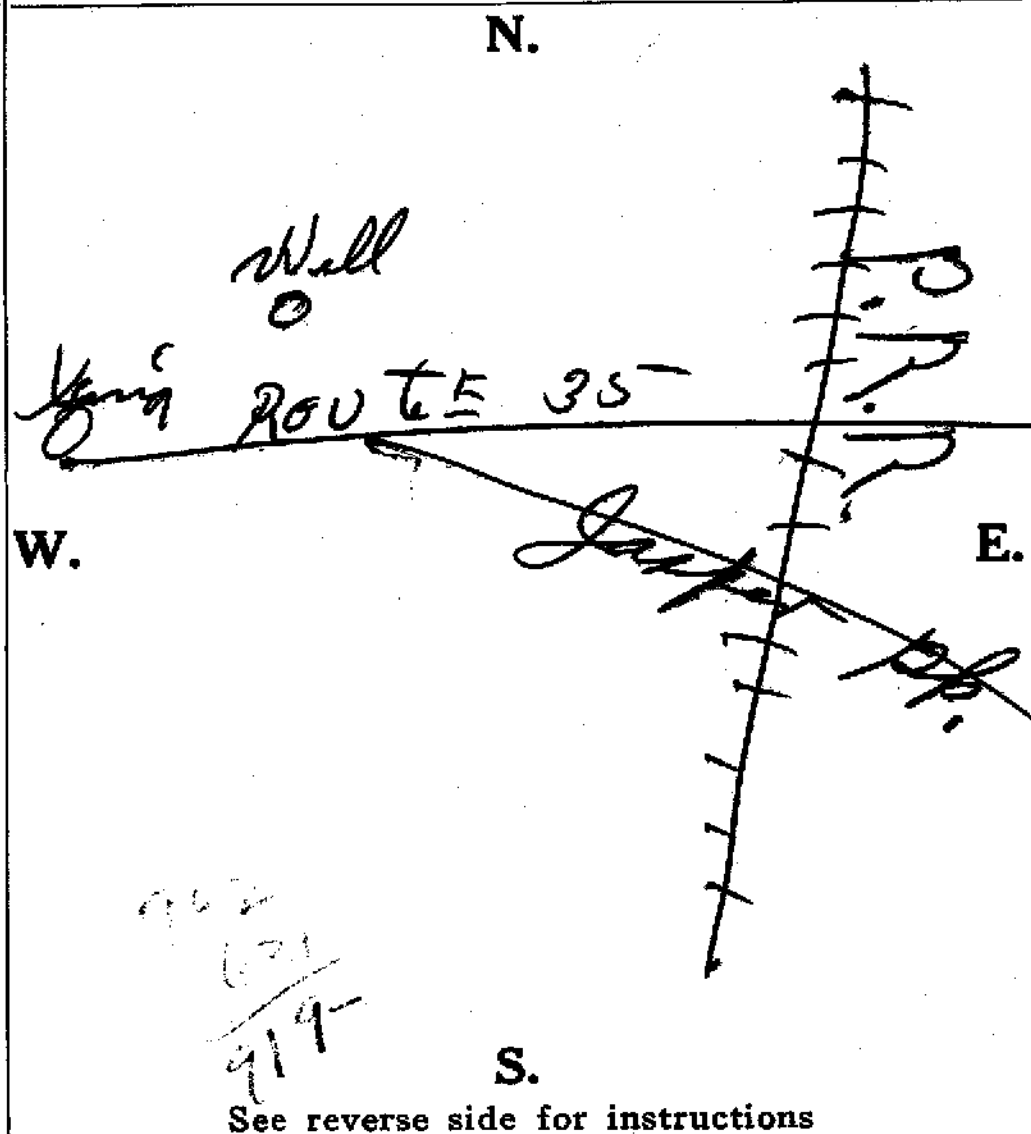

Drilling Firm Paul Bellamy
Address 613 N. Bellamy
Luria, O.

Date May 24 - 1962
Signed Paul Bellamy