

WELL LOG AND DRILLING REPORT

DNR 7802.05e

Ohio Department of Natural Resources
Division of Geological Survey, 2045 Morse Road, Columbus, Ohio 43229-6605
Phone (614) 265-6576

Well Log Number

3031948Page 1 of 2 for this record.

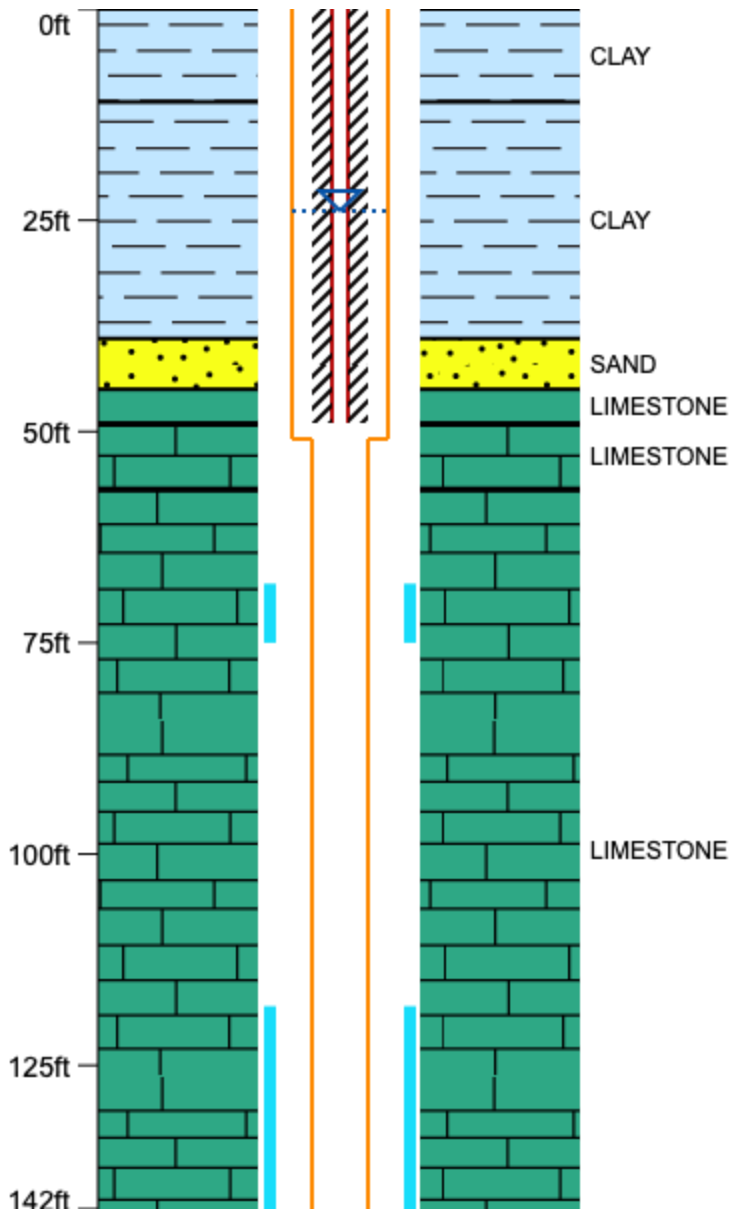
WELL LOCATION	CONSTRUCTION DETAILS																																													
County <u>AUGLAIZE</u> Township <u>MOULTON</u>	Drilling Method: <u>ROTARY</u>																																													
Owner/Builder <u>ST. PATRICK CHURCH</u>	BOREHOLE/CASING (Measured from ground surface)																																													
<u>6959 GLYNWOOD RD</u> Address of Well Location	1 { Borehole Diameter <u>9.75</u> inches Depth <u>51</u> ft. Casing Diameter <u>6</u> in. Length <u>51</u> ft. Thickness <u>0.316</u> in.																																													
City <u>ST. MARYS</u> Zip Code +4 <u>45885</u>	2 { Borehole Diameter <u>5.75</u> inches Depth <u>142</u> ft. Casing Diameter _____ in. Length _____ ft. Thickness _____ in.																																													
Permit No. <u>3894</u> Section; _____ and/or Lot No. _____	Casing Height Above Ground <u>2</u> ft.																																													
Use of Well <u>DOMESTIC</u>	Type { 1: <u>PVC</u> 2: _____																																													
Coordinates of Well (Use only one of the below coordinate systems)	Joints { 1: <u>SOLVENT</u> 2: _____																																													
Latitude, Longitude Coordinates	SCREEN																																													
Latitude: <u>40.58331</u> Longitude: <u>-84.31799</u>	Diameter _____ in. Slot Size _____ in. Screen Length _____ ft.																																													
Elevation of Well in feet: _____ +/- _____ ft.	Type _____ Material _____																																													
Datum Plane: ☐ NAD27 ☐ NAD83 Elevation Source <u>DIGITAL MAP</u>	Set Between _____ ft. and _____ ft.																																													
Source of Coordinates: <u>GPS</u>	GRAVEL PACK (Filter Pack)																																													
Well location written description:	Material/Size _____ Vol/Wt. Used _____																																													
<u>At the NW intersection of Glynwood New Knoxville Rd & Glynwood Rd.</u>	Method of Installation _____																																													
	Depth: Placed From: _____ ft. To: _____ ft.																																													
	GROUT																																													
	Material <u>BENTONITE SLURRY</u> Vol/Wt. Used <u>100GAL/250LBS</u>																																													
	Method of Installation <u>PUMPED WITH TREMIE PIPE</u>																																													
	Depth: Placed From: <u>0</u> ft. To: <u>51</u> ft.																																													
	DRILLING LOG*																																													
Comments on water quality/quantity and well construction:	FORMATIONS INCLUDE DEPTH(S) AT WHICH WATER IS ENCOUNTERED.																																													
<u>Clear, No Odor. Well Yields 125 GPM at Bottom.</u>	<table border="1" style="width:100%; border-collapse: collapse;"><thead><tr><th>Color</th><th>Texture</th><th>Formation</th><th>From</th><th>To</th></tr></thead><tbody><tr><td>BROWN</td><td></td><td>CLAY</td><td>0</td><td>11</td></tr><tr><td>GRAY</td><td></td><td>CLAY</td><td>11</td><td>39</td></tr><tr><td></td><td></td><td>SAND</td><td>39</td><td>45</td></tr><tr><td></td><td>BROKEN</td><td>LIMESTONE</td><td>45</td><td>49</td></tr><tr><td>TAN</td><td></td><td>LIMESTONE</td><td>49</td><td>57</td></tr><tr><td>GRAY</td><td></td><td>LIMESTONE</td><td>57</td><td>142</td></tr><tr><td></td><td></td><td>WATER AT</td><td>68</td><td>75</td></tr><tr><td></td><td></td><td>WATER AT</td><td>118</td><td>142</td></tr></tbody></table>	Color	Texture	Formation	From	To	BROWN		CLAY	0	11	GRAY		CLAY	11	39			SAND	39	45		BROKEN	LIMESTONE	45	49	TAN		LIMESTONE	49	57	GRAY		LIMESTONE	57	142			WATER AT	68	75			WATER AT	118	142
Color	Texture	Formation	From	To																																										
BROWN		CLAY	0	11																																										
GRAY		CLAY	11	39																																										
		SAND	39	45																																										
	BROKEN	LIMESTONE	45	49																																										
TAN		LIMESTONE	49	57																																										
GRAY		LIMESTONE	57	142																																										
		WATER AT	68	75																																										
		WATER AT	118	142																																										
WELL TEST *																																														
Pre-Pumping Static Level <u>24</u> ft. Date <u>8/6/2026</u>																																														
Measured from <u>TOP OF CASING</u>																																														
Pumping test method <u>AIR</u>																																														
Test Rate <u>125</u> gpm Duration of Test <u>1.5</u> hrs.																																														
Feet of Drawdown <u>60</u> ft. Sustainable Yield <u>125</u> gpm																																														
*(Attach a copy of the pumping test record, per section 1521.05, ORC)																																														
Is Copy Attached? ☐ Yes ☒ No Flowing Well? ☐ Yes ☒ No																																														
PUMP/PITLESS																																														
Type of pump _____ Capacity _____ gpm																																														
Pump set at _____ ft. Pitless Type _____																																														
Pump installed by _____																																														
I hereby certify the information given is accurate and correct to the best of my knowledge.																																														
Drilling Firm <u>QUINTER WELL DRILLING LLC</u>																																														
Address <u>29 S MILL ST</u>																																														
City, State, Zip <u>BURKETTSVILLE OH 45310</u>																																														
Signed <u>VIKKI QUINTER</u> Date <u>8/7/2026</u> (Filed Electronically)																																														
ODH Registration Number <u>000064</u> Last Revised on <u>8/7/2026</u>	Aquifer Type (Formation producing the most water.) <u>LIMESTONE</u>																																													
	Date of Well Completion <u>08/06/2026</u> Total Depth of Well <u>142</u> ft.																																													

Completion of this form is required by section 1521.05, Ohio Revised Code - file within 30 days after completion of drilling.
Distribute copies of this record to Customer, and Local Health Department.

WELL LOG AND DRILLING REPORT

Ohio Department of Natural Resources
Division of Water, 2045 Morse Road, Columbus, Ohio 43229-6605
Voice (614) 265-6740 Fax (614) 265-6767

Well Log Number

3031948Page 2 of 2 for this record.

String: 1

Borehole Depth: 51 ft.

Borehole Diameter: 9.75 in.

Casing Length: 51 ft.

Casing Diameter: 6 in.

String: 2

Borehole Depth: 142 ft.

Borehole Diameter: 5.75 in.

Casing Length: N/A

Casing Diameter: N/A

| Borehole

| Casing

/ Grout

| Water At

Static Water Level