

WELL LOG AND DRILLING REPORT

ORIGINAL

PLEASE USE PENCIL
OR TYPEWRITER
DO NOT USE INK.

State of Ohio
DEPARTMENT OF NATURAL RESOURCES
Division of Water
1562 W. First Avenue
Columbus 12, Ohio

Nº 310464

County Lorain Township Penfield Section of Township _____
Owner G. L. Brown Address Wellington Rd Box 178
Location of property 2 mi. S. of Penfield on St. Rt. 301 - E. side.

CONSTRUCTION DETAILS

Casing diameter 6 5/8" I.D. Length of casing 148 ft
Type of screen none Length of screen _____
Type of pump 1/2 H.P. Sub.
Capacity of pump 600 G.P.M.
Depth of pump setting 100'
Date of completion 8-3-65

BAILING OR PUMPING TEST

Pumping Rate 12 G.P.M. Duration of test 2 hrs.
Drawdown 100 ft. Date 7-12-65
Static level-depth to water 13 ft.
Quality (clear, cloudy, taste, odor) clear
Pump installed by Wood Drilling Co.

WELL LOG


Formations Sandstone, shale, limestone, gravel and clay	From	To
<u>Sand</u>	0 Feet	<u>10</u> Ft.
<u>Clay & Gravel</u>	<u>10</u>	<u>20</u>
<u>Clay</u>	<u>20</u>	<u>100</u>
<u>Clay & Sand</u>	<u>100</u>	<u>105</u>
<u>Gray Sand</u>	<u>105</u>	<u>138</u>
<u>Coarse Sand & Gravel</u>	<u>138</u>	<u>148</u>

Pipe perforated 4' in bottom
Hole filled on itself
to 120' and water cleared
right up.

Water 140-146'

SKETCH SHOWING LOCATION

Locate in reference to numbered
State Highways, St. Intersections, County roads, etc.

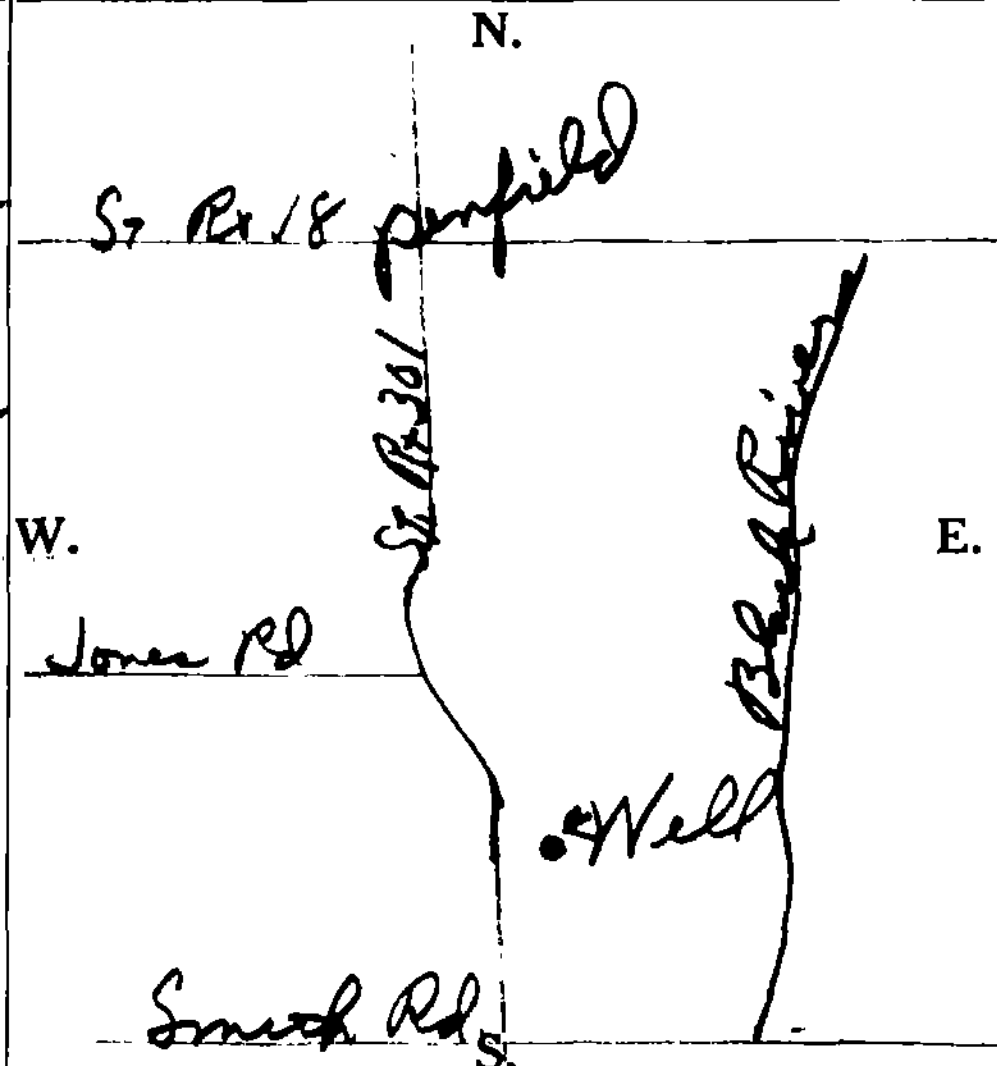

See reverse side for instructions

Drilling Firm Wood Drilling
Address R. D. 3 West Salem

Date 8-3-65
Signed H. Dean Wood