

WELL LOG AND DRILLING REPORT

ORIGINAL

PLEASE USE PENCIL
OR TYPEWRITER
DO NOT USE INK.State of Ohio
DEPARTMENT OF NATURAL RESOURCES
Division of Water
1562 W. First Avenue
Columbus 12, Ohio

No 321398

County SUMMIT Township NORTON Section of TownshipOwner ROBERT HONEYCUTT Address BARBERTON, O.Location of property 4230 REIMER RD

CONSTRUCTION DETAILS

Casing diameter 5" Length of casing 39'
Type of screen NONE Length of screen
Type of pump
Capacity of pump
Depth of pump setting
Date of completion

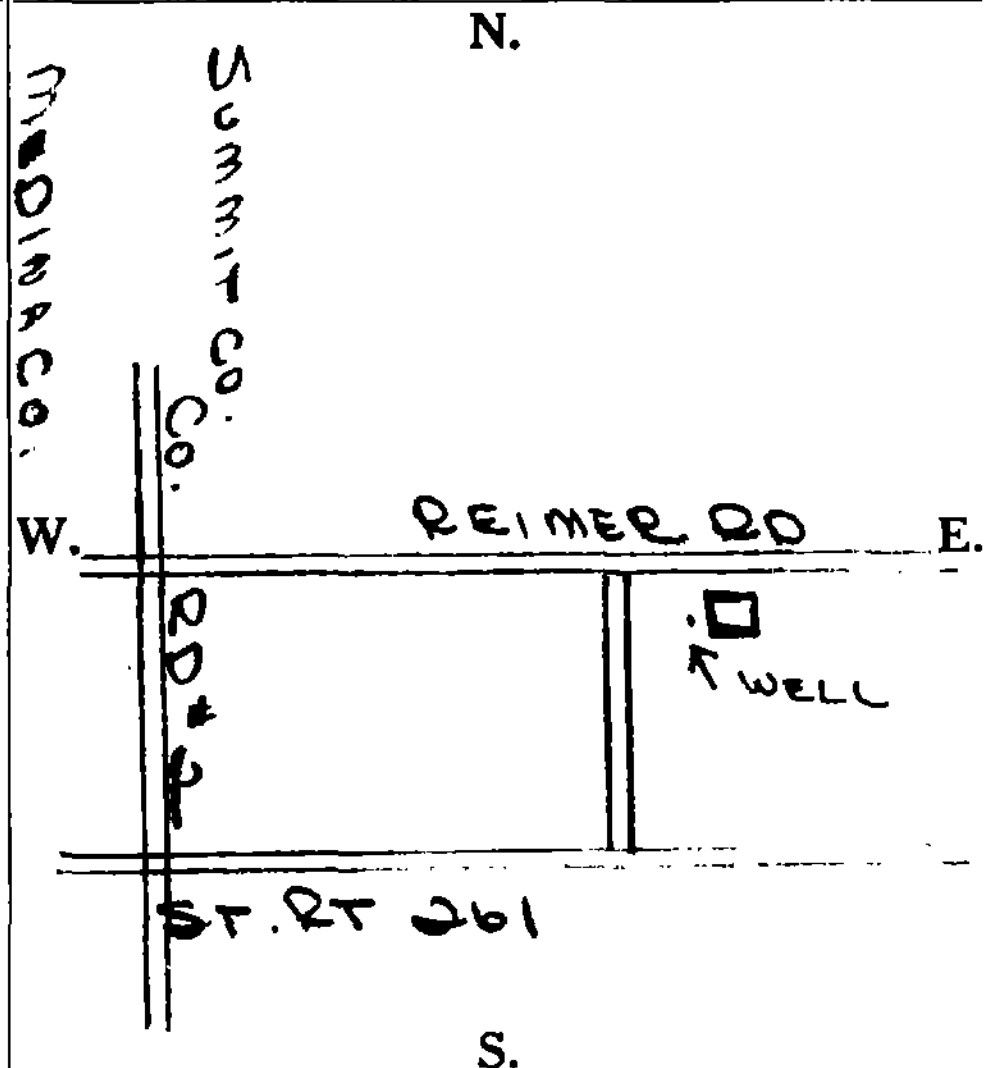
BAILING OR PUMPING TEST

Pumping Rate 15 G.P.M. Duration of test 2 hrs.
Drawdown NONE ft. Date 4/23/66
Static level-depth to water 70' ft.
Quality (clear, cloudy, taste, odor) CLOUDY
Pump installed by DRILLER

WELL LOG

Formations Sandstone, shale, limestone, gravel and clay	From	To
	0 Feet	Ft.
CLAY, YELLOW & SAND		20'
CLAY, GRAY & SAND	20'	27'
ROCK, GRAY SAND	27'	35'
ROCK, YELLOW SAND	35'	50'
ROCK, GRAY SAND	50'	60'
ROCK, GRAY SHALE	60'	76'
ROCK, GRAY SAND	76'	87'
ROCK, GRAY SHALE	87'	95'
ROCK GRAY SAND	95'	100'
FIRST WATER	78'	20 GPM
SECOND WATER	96'	13 GPM
6 5/8" HOLE	38'	
CEMENTED IN		

SKETCH SHOWING LOCATION

Locate in reference to numbered
State Highways, St. Intersections, County roads, etc.

See reverse side for instructions

Drilling Firm WADSWORTH SUPPLYAddress 8040 RIDGE RDWADSWORTH, O.Date 4/23/66Signed [Signature]