

WELL LOG AND DRILLING REPORT

ORIGINAL

PLEASE USE PENCIL
OR TYPEWRITER

State of Ohio
DEPARTMENT OF NATURAL RESOURCES

No 339049

DO NOT USE INK.

Division of Water
1562 W. First Avenue
Columbus, Ohio 43212

County Huron Township ~~Williamstown~~ ^{Williamstown} Section of Township 10
Owner Jane Beeching Address 15W Jefferson Shelby 04075
Location of property Center of Cellerlyville Across St. from Christ. Reformation Church
1st House S. of Arco Buena Vista Well (W. Side)

CONSTRUCTION DETAILS

Casing diameter 4 1/4 Length of casing 68'
Type of screen Cent. slot Length of screen 5'
Type of pump Sub
Capacity of pump Approx 10 gpm
Depth of pump setting 55'
Date of completion 7-2-77

BAILING OR PUMPING TEST


Pumping Rate 40 G.P.M. Duration of test 6 hrs.
Drawdown 18 ft. Date 6-30-77
Static level-depth to water 39 ft.
Quality (clear, cloudy, taste, odor) Mild Saltier
Pump installed by Driller.

WELL LOG*

Formations Sandstone, shale, limestone, gravel and clay	From	To
<u>y-clay</u>	<u>0 Feet</u>	<u>20 Ft.</u>
<u>Bl. "</u>	<u>20</u>	<u>59</u>
<u>Fine Water Sand</u>	<u>59</u>	<u>68</u>
<u>Anal</u>		
<u>Ph. 8</u>		
<u>Iron 1 ppm</u>		
<u>Ndn 4 gpg</u>		

SKETCH SHOWING LOCATION

Locate in reference to numbered
State Highways, St. Intersections, County roads, etc.

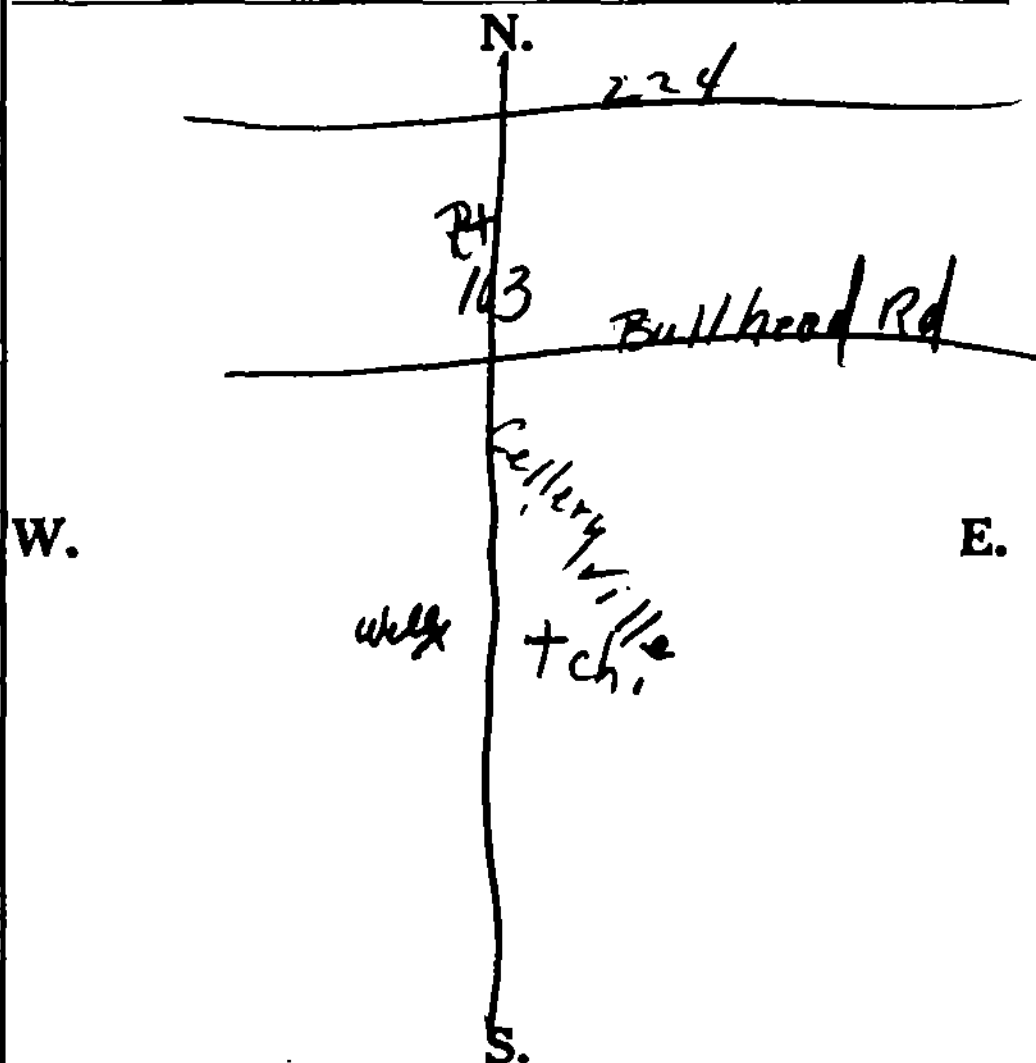

See reverse side for instructions

Drilling Firm M. R. Fife
Address Greenwich OH 44837

Date 7-4-77
Signed M. R. Fife

*If additional space is needed to complete well log, use next consecutive numbered form.