

WELL-LOG AND DRILLING REPORT

ORIGINAL

PLEASE USE PENCIL
OR TYPEWRITER

DO NOT USE INK.

State of Ohio
DEPARTMENT OF NATURAL RESOURCES
Division of Water
1562 W. First Avenue
Columbus, Ohio 43212

LOCATED

No 359181

County Madison Township Union Section of Township

Owner State of Ohio-Natural Resources Address London Fish Hatchery

Location of property Roberts Mill rd. and Old Springfield Rd.

CONSTRUCTION DETAILS

Below LS
Casing diameter 10" Length of casing 45' 1"
Type of screen 125 Slot Length of screen 6' 8 1/2"
Type of pump
Capacity of pump
Depth of pump setting
Date of completion March 25, 1968

BAILING OR PUMPING TEST


Pumping Rate 190 G.P.M. Duration of test 8 hrs.
Drawdown 14.94 ft. Date March 25, 1968
Static level-depth to water at Land Surface ft.
Quality (clear, cloudy, taste, odor) Clear
Pump installed by

Well No. 2 WELL LOG*

Formations Sandstone, shale, limestone, gravel and clay	From	To
Sandy Clay	0 Feet	10 Ft.
Fine to Med. Muddy Gravel	10	15
Grey Sandy Clay-Fine Gravel	15	40
Med. to Coarse Grey Sand		
10% Fine Gravel-Clay Trace	40	43
Med. to Coarse Grey Gravel		
1/2 to 1" dia.-15% coarse sand-heavy silt	43	45
Med. to Coarse Grey Sand		
50% Fine to Med. Gravel	45	50
1/2 to 1" dia.-heavy silt		
Grey Clay Hardpan	50	54

SKETCH SHOWING LOCATION

Locate in reference to numbered
State Highways, St. Intersections, County roads, etc.

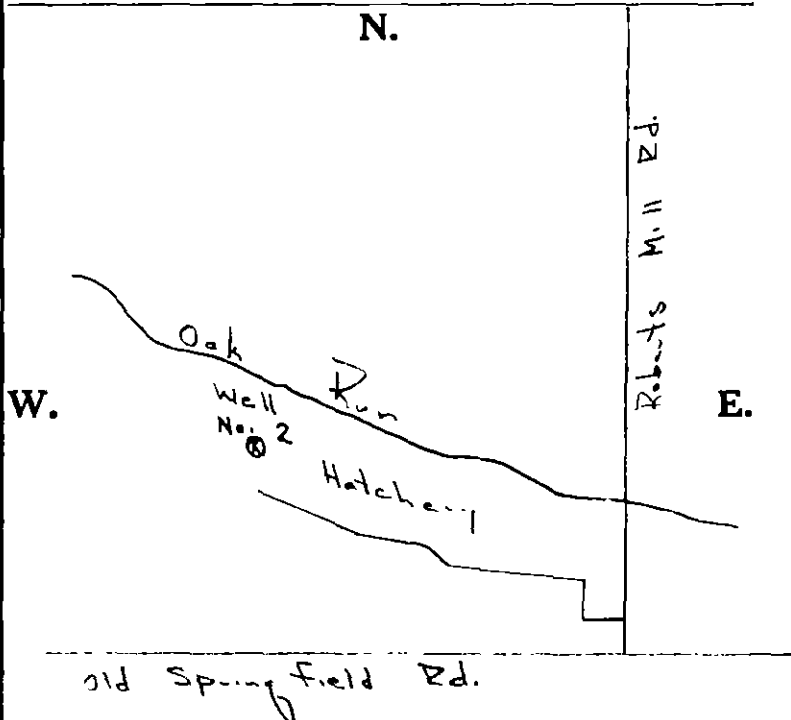

See reverse side for instructions

Drilling Firm Hamm Drilling, Inc.

Date March 26, 1968

Address 3912 Mountview Rd., Columbus

Signed Ernest G. Hamm

*If additional space is needed to complete well log, use next consecutive numbered form.

46