

WELL LOG AND DRILLING REPORT

LOCATED

ORIGINAL

PLEASE USE PENCIL
OR TYPEWRITER

State of Ohio
DEPARTMENT OF NATURAL RESOURCES

No 359182

DO NOT USE INK.

Division of Water
1562 W. First Avenue
Columbus, Ohio 43212

County Madison Township Union Section of Township _____

Owner Ohio Dept. of Natural Resources Address London Fish Hatchery

Location of property Roberts Mill Rd. and Old Springfield Rd.

CONSTRUCTION DETAILS

Casing diameter 10" Length of casing 46'
Type of screen 125 slot Red Brass Length of screen 7'-6 3/4"
Type of pump _____
Capacity of pump _____
Depth of pump setting _____
Date of completion April 12, 1968

BAILING OR PUMPING TEST


Pumping Rate 201 G.P.M. Duration of test 8 hrs.
Drawdown 10.02 ft. Date May 9, 1968
Static level-depth to water 3.75 above l.s. ft.
Quality (clear, cloudy, taste, odor) Clear
1.1 ppm Fe - 20 grains Hardness
Pump installed by _____

Well No. 1 WELL LOG*

Formations Sandstone, shale, limestone, gravel and clay	From	To
<u>Black Soil</u>	<u>0 Feet</u>	<u>4 Ft.</u>
<u>Brown Sandy Clay</u>	<u>4</u>	<u>18</u>
<u>Grey Sandy Clay</u>	<u>18</u>	<u>34</u>
<u>Grey Clay and Gravel - Water 34'</u>	<u>34</u>	<u>39</u>
<u>Fine to Med. Meddy Gravel 1/4"</u>	<u>39</u>	<u>41</u>
<u>Fine to Med. Grey Gravel 1/4"</u>	<u>41</u>	<u>49</u>
<u>to 1" dia. - 30% coarse sand</u>		
<u>heavy silt</u>		
<u>Grey Clay Hardpan Pulled</u>	<u>49</u>	<u>58</u>
<u>Back</u>		
<u>Screen Set 39 to 46'</u>		

SKETCH SHOWING LOCATION

Locate in reference to numbered
State Highways, St. Intersections, County roads, etc.

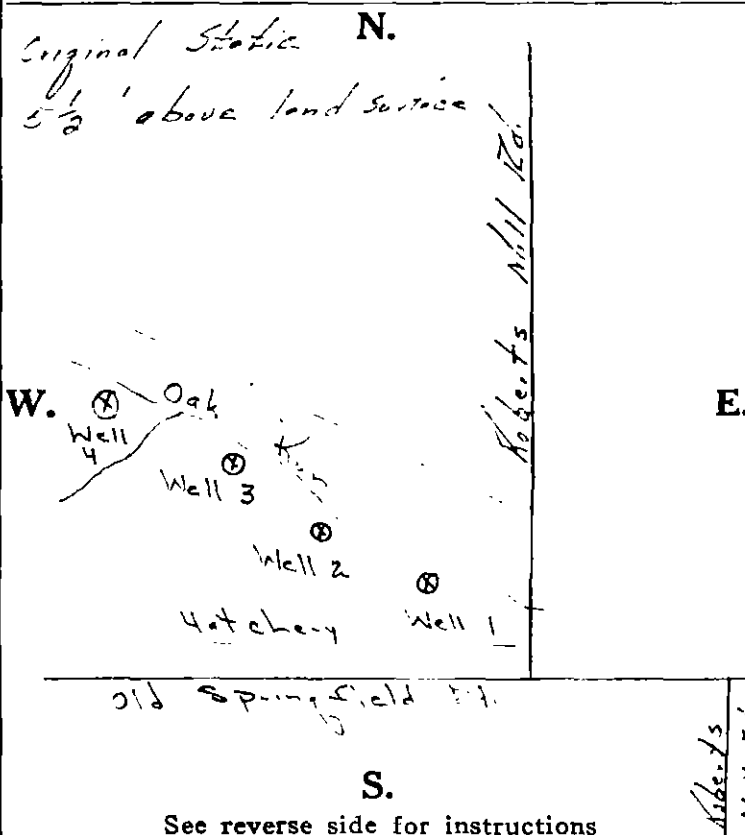

Drilling Firm Hamm Drilling, Inc.
Address 2912 Mountain Pt. Columbus, O.

Date May 20, 1968
Signed E. J. Hamm, Inc.

*If additional space is needed to complete well log, use next consecutive numbered form.