

WELL LOG AND DRILLING REPORT

ORIGINAL

116

PLEASE USE PENCIL
OR TYPEWRITER

DO NOT USE INK.

State of Ohio
DEPARTMENT OF NATURAL RESOURCES

Division of Water
1562 W. First Avenue
Columbus, Ohio 43212

No 362951

County Coshocton Township Bethlehem Section of Township _____

Owner Byron Tatro Address Rt. 1 Coshocton, Ohio

Location of property 1 mile S. of Rt. (36) on Road 3996

CONSTRUCTION DETAILS

Casing diameter 5 1/2" O.D. Length of casing 121'-3"
Type of screen Shoe Length of screen —
Type of pump Submersible
Capacity of pump 6 G.P.M.
Depth of pump setting 168' of 1" Gal. Pipe
Date of completion June 24, 67

BAILING OR PUMPING TEST


Pumping Rate 2 1/2 G.P.M. Duration of test Four hrs.
Drawdown Dry ft. Date June 10, 67
Static level-depth to water 62' ft.
Quality (clear, cloudy, taste, odor) Ph - 7.8
Iron - 3 Hardness - 11
Pump installed by Denver Randles

WELL LOG*

Formations Sandstone, shale, limestone, gravel and clay	From	To
<u>Soil</u>	<u>0 Feet</u>	<u>2 Ft.</u>
<u>Blue Clay</u>	<u>2</u>	<u>6</u>
<u>Blue Clay</u>	<u>6</u>	<u>25</u>
<u>Sand & Clay</u>	<u>25</u>	<u>36</u>
<u>Clay & Sand</u>	<u>36</u>	<u>75</u>
<u>Gray Clay</u>	<u>75</u>	<u>121</u>
<u>Sandy Shale</u>	<u>121</u>	<u>158</u>
<u>Fine Sandstone</u>	<u>158</u>	<u>165</u>
<u>Sandy Shale</u>	<u>165</u>	<u>175</u>
<u>Water</u>	<u>158</u>	<u>165</u>

SKETCH SHOWING LOCATION

Locate in reference to numbered
State Highways, St. Intersections, County roads, etc.

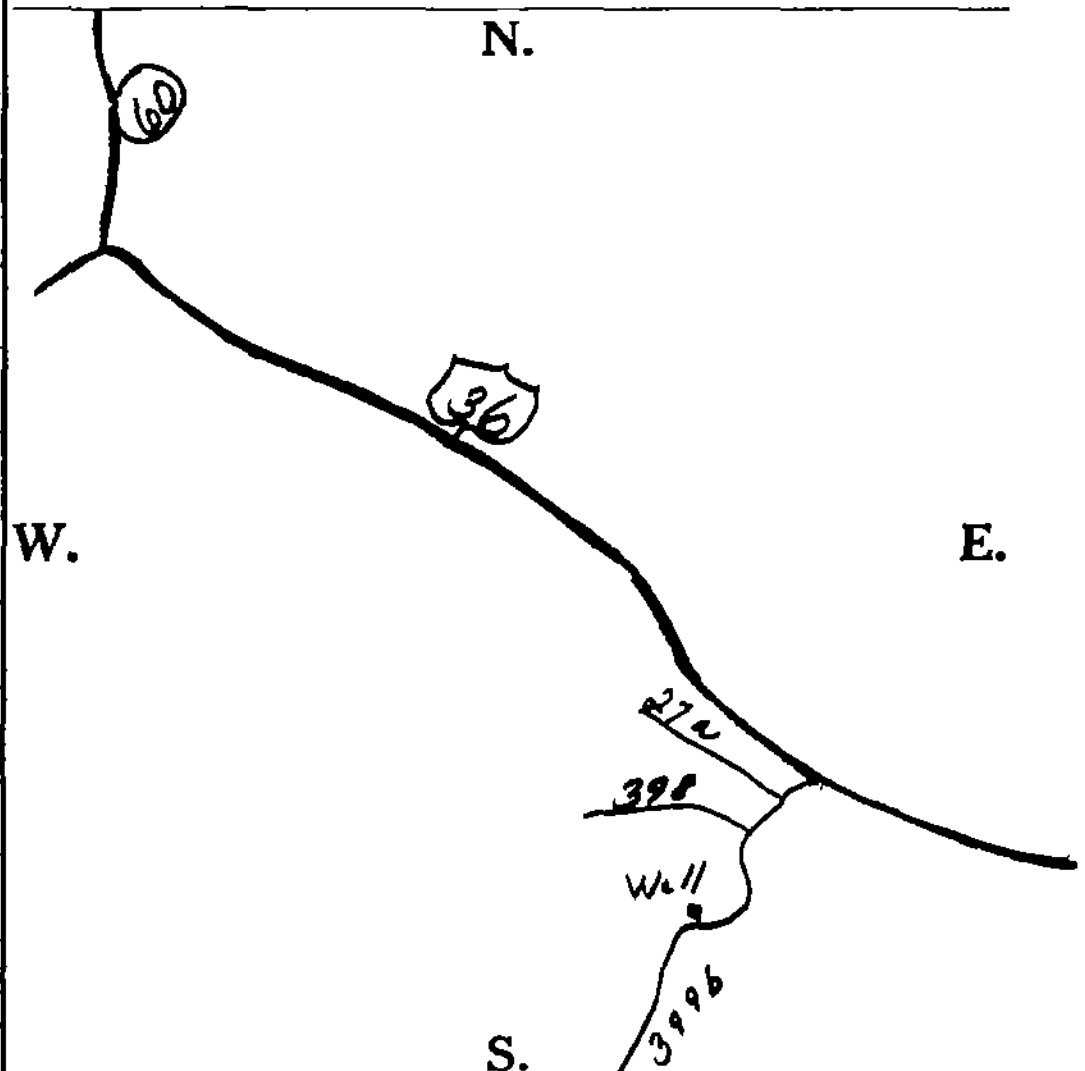

See reverse side for instructions

Drilling Firm Randles Well Drilling Co.

Date Feb. 20, 68

Address Rt. 2 Warsaw, Ohio

Signed Denver E. Randles

*If additional space is needed to complete well log, use next consecutive numbered form.