

WELL LOG AND DRILLING REPORT

ORIGINAL

PLEASE USE PENCIL
OR TYPEWRITER

DO NOT USE INK.

State of Ohio
DEPARTMENT OF NATURAL RESOURCES

Division of Water
1562 W. First Avenue
Columbus, Ohio 43212

No 362953

County Coshocton Township Bethlehem Section of Township Lot 24

Owner Don Deliore (Builder) Address Rt. 3 Warsaw, Ohio

Location of property See Map

CONSTRUCTION DETAILS

Casing diameter 5 1/2" O.D. Length of casing 81'
Type of screen Perforated Length of screen —
Type of pump Submersible
Capacity of pump 18 G.P.M.
Depth of pump setting 63' of 1" Gal. Pipe
Date of completion June 19, 67

BAILING OR PUMPING TEST


Pumping Rate 24 G.P.M. Duration of test Two hrs.
Drawdown 2 ft. Date June 15, 67
Static level-depth to water 30 ft.
Quality (clear, cloudy, taste, odor) Ph - 7.3
Iron - 2.5 Hardness - 16
Pump installed by Denny Randles

WELL LOG*

Formations Sandstone, shale, limestone, gravel and clay	From	To
<u>Clay</u>	<u>0 Feet</u>	<u>4 Ft.</u>
<u>Clay + Boulders</u>	<u>4</u>	<u>25</u>
<u>Sand + Gravel</u>	<u>25</u>	<u>37</u>
<u>Fine Sand</u>	<u>37</u>	<u>48</u>
<u>Fine Blue Sand</u>	<u>48</u>	<u>65</u>
<u>F. Brown Sand</u>	<u>65</u>	<u>72</u>
<u>Sand + Gravel</u>	<u>72</u>	<u>81</u>
<u>Screen</u>	<u>74</u>	<u>79</u>
<u>Water</u>	<u>74</u>	<u>79</u>

SKETCH SHOWING LOCATION

Locate in reference to numbered
State Highways, St. Intersections, County roads, etc.

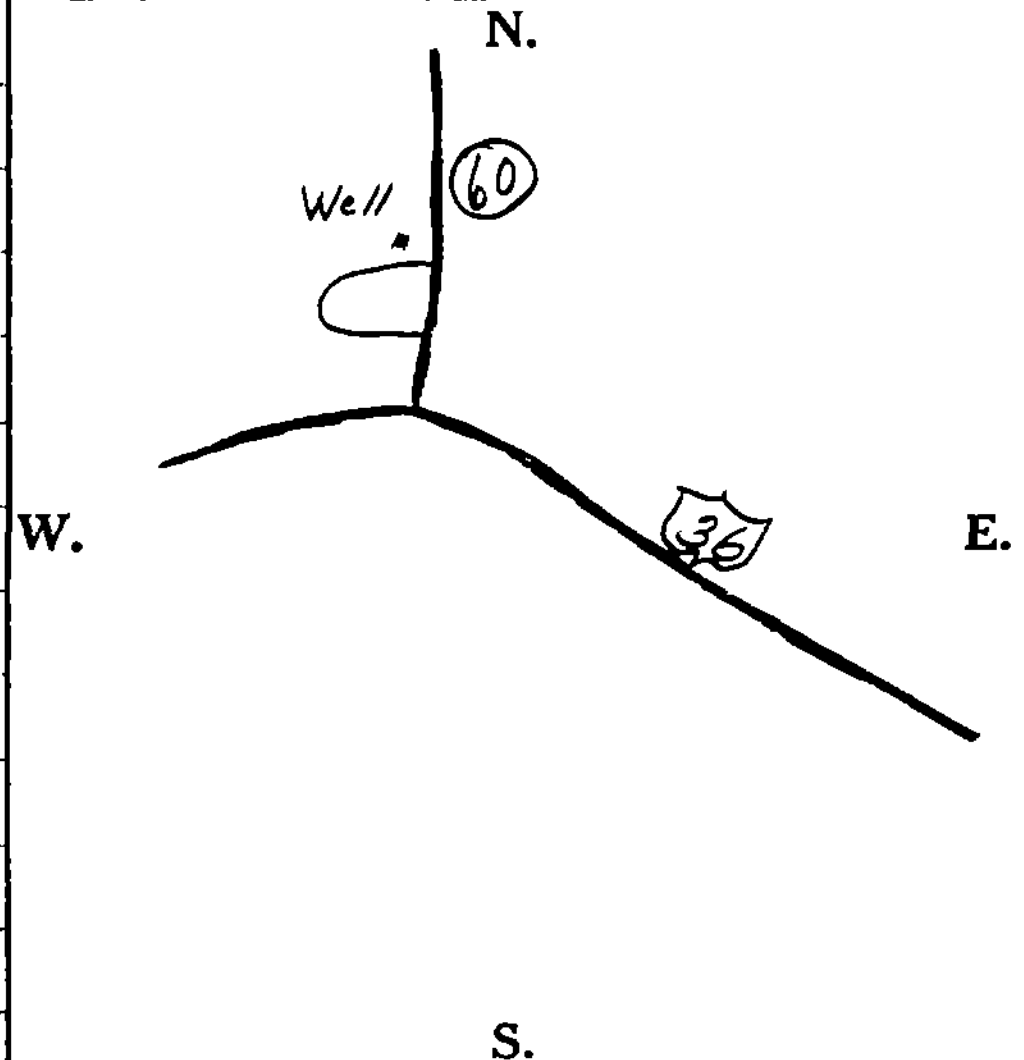

See reverse side for instructions

Drilling Firm Randles Well Drilling Co.

Date Feb. 20, 68

Address Rt. 2 Warsaw, Ohio

Signed Denny E. Randles

*If additional space is needed to complete well log, use next consecutive numbered form.

B28