

WELL LOG AND DRILLING REPORT

ORIGINAL

PLEASE USE PENCIL
OR TYPEWRITER

State of Ohio
DEPARTMENT OF NATURAL RESOURCES

Division of Water
1562 W. First Avenue
Columbus, Ohio 43212

No 370097

County Carroll Township Brown Section of Township 1

Owner Larry Woyandt Address 3258 Salineville Rd NE Carrollton Ohio

Location of property on the NW corner of the ltc of Co Rd 68 Citrus Rd & Letin Rd

CONSTRUCTION DETAILS

Casing diameter 5 9/16" Length of casing 39'
Type of screen _____ Length of screen _____
Type of pump Submersible
Capacity of pump 1 hp
Depth of pump setting 235'
Date of completion 12-20-79

BAILING OR PUMPING TEST


Pumping Rate 9 G.P.M. Duration of test _____ hrs.
Drawdown 180 ft. Date 12-20-79
Static level-depth to water 70' ft.
Quality (clear, cloudy, taste, odor) Cloudy
Pump installed by Owner

WELL LOG*

Formations Sandstone, shale, limestone, gravel and clay	From	To
<u>Soil</u>	<u>0 Feet</u>	<u>2 Ft.</u>
<u>Sandy Shale</u>	<u>4'</u>	<u>20'</u>
<u>Gray Shale</u>	<u>20'</u>	<u>60'</u>
<u>Dark Shale</u>	<u>60'</u>	<u>90'</u>
<u>Sandy Shale w/ Lime Shells</u>	<u>90'</u>	<u>160'</u>
<u>Shale w/ Lime Shells</u>	<u>160'</u>	<u>190'</u>
<u>Shells & Shale</u>	<u>190'</u>	<u>210'</u>
<u>Sandy Shale w/ Lime Shells</u>	<u>210'</u>	<u>250'</u>

SKETCH SHOWING LOCATION

Locate in reference to numbered
State Highways, St. Intersections, County roads, etc.

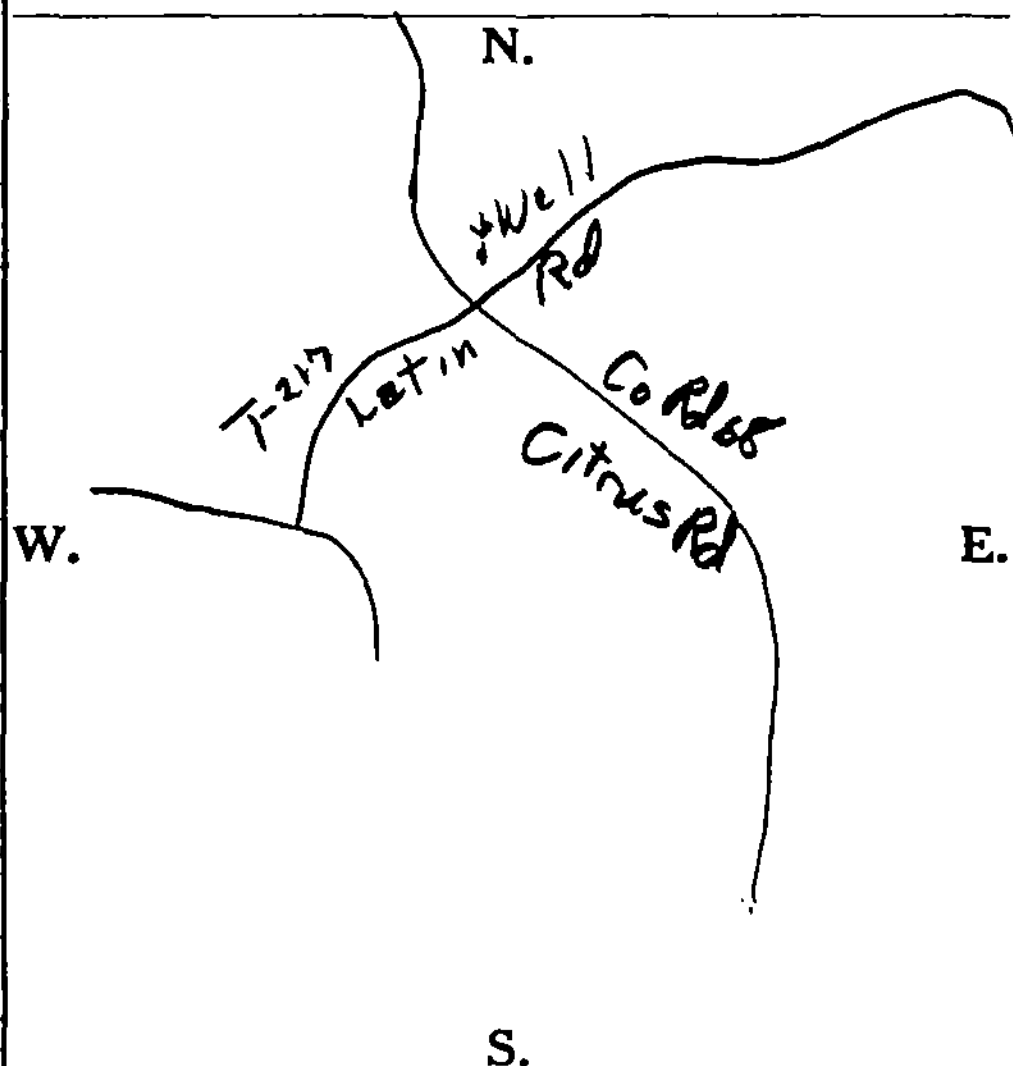

See reverse side for instructions

Drilling Firm Speedy Drilling Co
Address Carrollton, Ohio

Date 1-1-80
Signed Glenn P. Speedy (21)

*If additional space is needed to complete well log, use next consecutive numbered form.