

WELL LOG AND DRILLING REPORT

ORIGINAL

NO CARBON PAPER
NECESSARY—
SELF-TRANSCRIBING

State of Ohio
DEPARTMENT OF NATURAL RESOURCES
Division of Water
65 S. Front St., Rm. 815 Phone (614) 469-2646
Columbus, Ohio 43215

No. 388864

County Medina Township Sitchfield Section of Township Southeast
Owner Frank Samlow Address Sitchfield Ohio
Location of property on G Rt 106 - 1/2 mi S. of County Rt 74

CONSTRUCTION DETAILS

Casing diameter 6" O.D. Length of casing 44
Type of screen _____ Length of screen _____
Type of pump _____
Capacity of pump _____
Depth of pump setting _____
Date of completion _____

BAILING OR PUMPING TEST (Specify one by circling)


Test Rate 6 G.P.M. Duration of test 2 hrs.
Drawdown 25 ft. Date 7/15/69
Static level-depth to water 30 ft.
Quality (clear, cloudy, taste, odor) clear
Pump installed by Bailer Test

WELL LOG*

Formations Sandstone, shale, limestone, gravel and clay	From	To
<u>Br. clay + gravel</u>	<u>0 Feet</u>	<u>16 Ft.</u>
<u>gray clay</u>	<u>16</u>	<u>36</u>
<u>Broken Shale Rock</u>	<u>36</u>	<u>42</u>
<u>Sandy Shale - Hard</u>	<u>42</u>	<u>78</u>
<u>water at</u>	<u>70'</u>	

SKETCH SHOWING LOCATION

Locate in reference to numbered
State Highways, St. Intersections, County roads, etc.

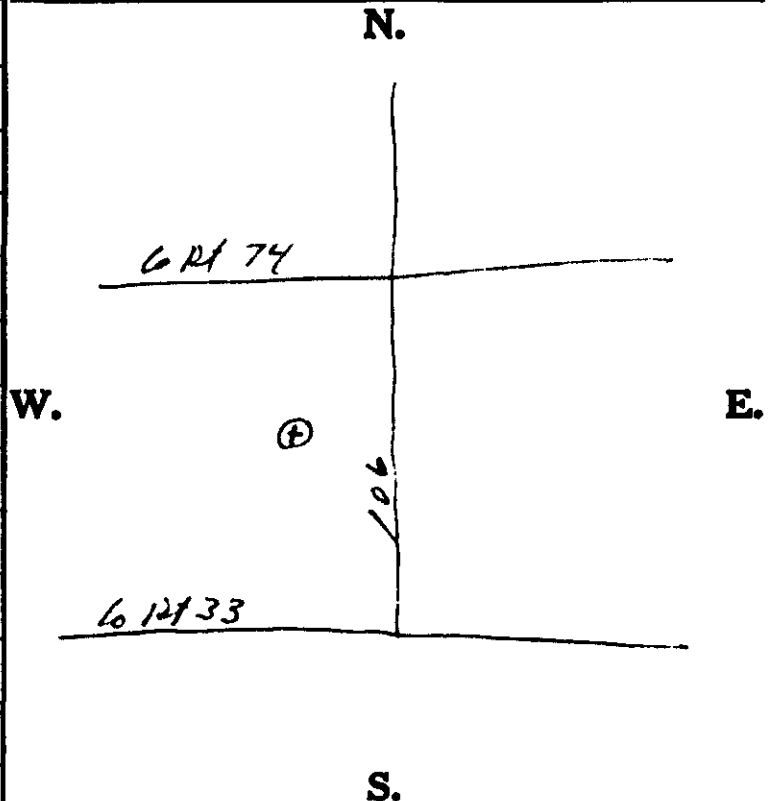

Drilling Firm Mack Drilling
Address Valley City, O

Date 7/16/69
Signed Robert E. Mack

*If additional space is needed to complete well log, use next consecutive numbered form.

LOCATED
118