

WELL LOG AND DRILLING REPORT

ORIGINAL

NO CARBON PAPER
NECESSARY—
SELF-TRANSCRIBING

State of Ohio
DEPARTMENT OF NATURAL RESOURCES
Division of Water
65 S. Front St., Rm. 815 Phone (614) 469-2646
Columbus, Ohio 43215

No. 398528

County FRANKLIN Township NEWLICK Section of Township 4

Owner ELDON SCHATS Address Hilliard Ohio

Location of property 3/4 MILE W/DAVEY RD ON HAYDEN RUN RD

CONSTRUCTION DETAILS

Casing diameter 4 1/4 Length of casing 77-8'
Type of screen NONE Length of screen
Type of pump DEEP WELL
Capacity of pump
Depth of pump setting 55
Date of completion 11-15-70

BAILING OR PUMPING TEST (Specify one by circling)


Test Rate 15 G.P.M. Duration of test 1 hrs.
Drawdown 10 ft. Date 11
Static level-depth to water 26 ft.
Quality (clear, cloudy, taste, odor) CLEAR
Pump installed by

WELL LOG*

Formations Sandstone, shale, limestone, gravel and clay	From	To
<u>YELLOW CLAY</u>	<u>0 Feet</u>	<u>22 Ft.</u>
<u>BLUE-CLAY</u>	<u>22</u>	<u>44</u>
<u>SAND-POSSIBLE ROCK</u>	<u>44</u>	<u>77</u>
<u>LIME-STONE</u>	<u>77</u>	<u>104'</u>
<u>WATER AT</u>		
<u>104'</u>		

SKETCH SHOWING LOCATION

Locate in reference to numbered
State Highways, St. Intersections, County roads, etc.

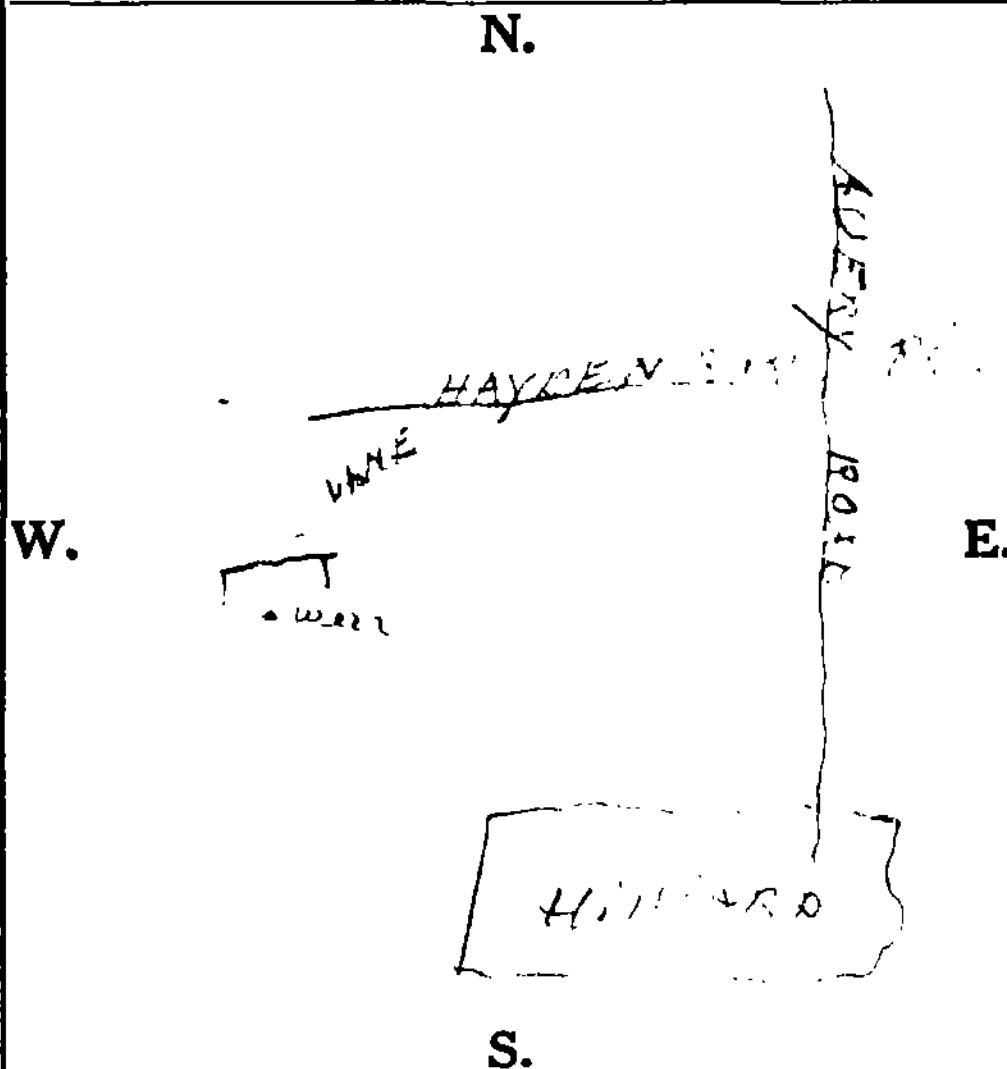

Drilling Firm ELAM CARTER
Address 5324 W. BROAD ST
COLUMBIA OHIO

Date 12-7-1970
Signed Elam Carter

*If additional space is needed to complete well log, use next consecutive numbered form.