

WELL LOG AND DRILLING REPORT

ORIGINAL

LOCATED

No. 398529

NO CARBON PAPER
NECESSARY—
SELF-TRANSCRIBING

State of Ohio
DEPARTMENT OF NATURAL RESOURCES
Division of Water
65 S. Front St., Rm. 815 Phone (614) 469-2646
Columbus, Ohio 43215

County MADISON Township FAIRFIELD Section of Township _____

Owner RONALD G. GUYTON Address 606 GLENMORE DR COL. OHIO

Location of property 1/2 MILE S/2665 ON PASSUM RUN ROAD AT 5496

CONSTRUCTION DETAILS

Casing diameter 4 1/4 Length of casing 133
Type of screen NONE Length of screen —
Type of pump DEEP WELL
Capacity of pump 10 GALL PER MIN
Depth of pump setting 100
Date of completion 6-1-1971

BAILING OR PUMPING TEST (Specify one by circling)


Test Rate 10 G.P.M. Duration of test 20 hrs.
Drawdown 10 ft. Date 5-31-1971
Static level-depth to water 63 ft.
Quality (clear, cloudy, taste, odor) CLEAR
Pump installed by _____

WELL LOG*

Formations Sandstone, shale, limestone, gravel and clay	From	To
<u>YELLOW-CLAY</u>	0 Feet	25-Ft.
<u>BLUE-CLAY</u>	25	60
<u>FINE-SAND</u>	60	65
<u>BLUE-CLAY</u>	65	80
<u>SAND</u>	80	90
<u>BLUE-CLAY</u>	90	115
<u>RED-CLAY</u>	115	125
<u>SAND</u>	125	133
<u>LIME-STONE</u>	133	192
<u>WATER AT</u>		
<u>192'</u>		

SKETCH SHOWING LOCATION

Locate in reference to numbered
State Highways, St. Intersections, County roads, etc.

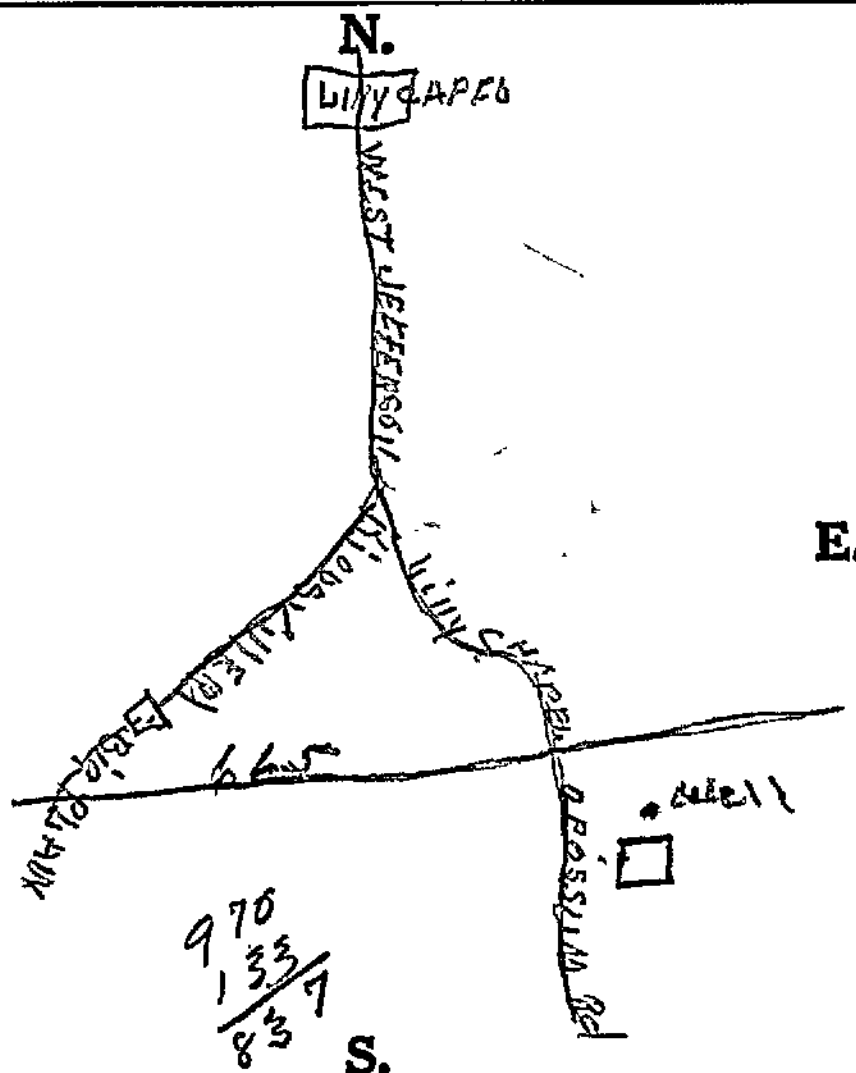

Drilling Firm FLAM CARTER

Date 6-5-1971

Address 5378 W. BRAD ST
COLUMBIA

Signed Ed. O. Carter

*If additional space is needed to complete well log, use next consecutive numbered form.