

WELL LOG AND DRILLING REPORT

ORIGINAL

12

NO CARBON PAPER
NECESSARY—
SELF-TRANSCRIBING

State of Ohio
DEPARTMENT OF NATURAL RESOURCES
Division of Water
65 S. Front St., Rm. 815 Phone (614) 469-2646
Columbus, Ohio 43215

No. 401415

County Holmes Township Mechanic Section of Township 10
Owner Mr. Horace Dutton Address R.R. 2, Millersburg, Ohio
Location of property 5 mi south of Millersburg off St. Rt 76

CONSTRUCTION DETAILS

Casing diameter 5" Length of casing 182
Type of screen NONE Length of screen _____
Type of pump sub.
Capacity of pump 10 GPM.
Depth of pump setting 275
Date of completion 6/11/71

BAILING OR PUMPING TEST (Specify one by circling)


Test Rate 30 G.P.M. Duration of test 1 1/2 hrs.
Drawdown NONE ft. Date 6/10/71
Static level-depth to water 250 ft.
Quality (clear, cloudy, taste, odor) clear
Pump installed by Morany Dely Co.

WELL LOG*

Formations Sandstone, shale, limestone, gravel and clay	From	To
<u>Top soil</u>	<u>0 Feet</u>	<u>5 Ft.</u>
<u>clay</u>	<u>5</u>	<u>16</u>
<u>yellow sand stone</u>	<u>16</u>	<u>38</u>
<u>gray sand</u>	<u>38</u>	<u>43</u>
<u>Fire Clay</u>	<u>43</u>	<u>62</u>
<u>sandy shale</u>	<u>62</u>	<u>78</u>
<u>gray shale</u>	<u>78</u>	<u>86</u>
<u>lime stone</u>	<u>86</u>	<u>91</u>
<u>white shale</u>	<u>91</u>	<u>101</u>
<u>Fire Clay</u>	<u>101</u>	<u>108</u>
<u>sand stone</u>	<u>108</u>	<u>138</u>
<u>Brown sand stone</u>	<u>138</u>	<u>155</u>
<u>gray shale</u>	<u>155</u>	<u>160</u>
<u>black shale</u>	<u>160</u>	<u>165</u>
<u>lime stone</u>	<u>165</u>	<u>169</u>
<u>gray sand stone</u>	<u>169</u>	<u>174</u>
<u>gray shale</u>	<u>174</u>	<u>225</u>
<u>white sand</u>	<u>225</u>	<u>287</u>

SKETCH SHOWING LOCATION

Locate in reference to numbered
State Highways, St. Intersections, County roads, etc.

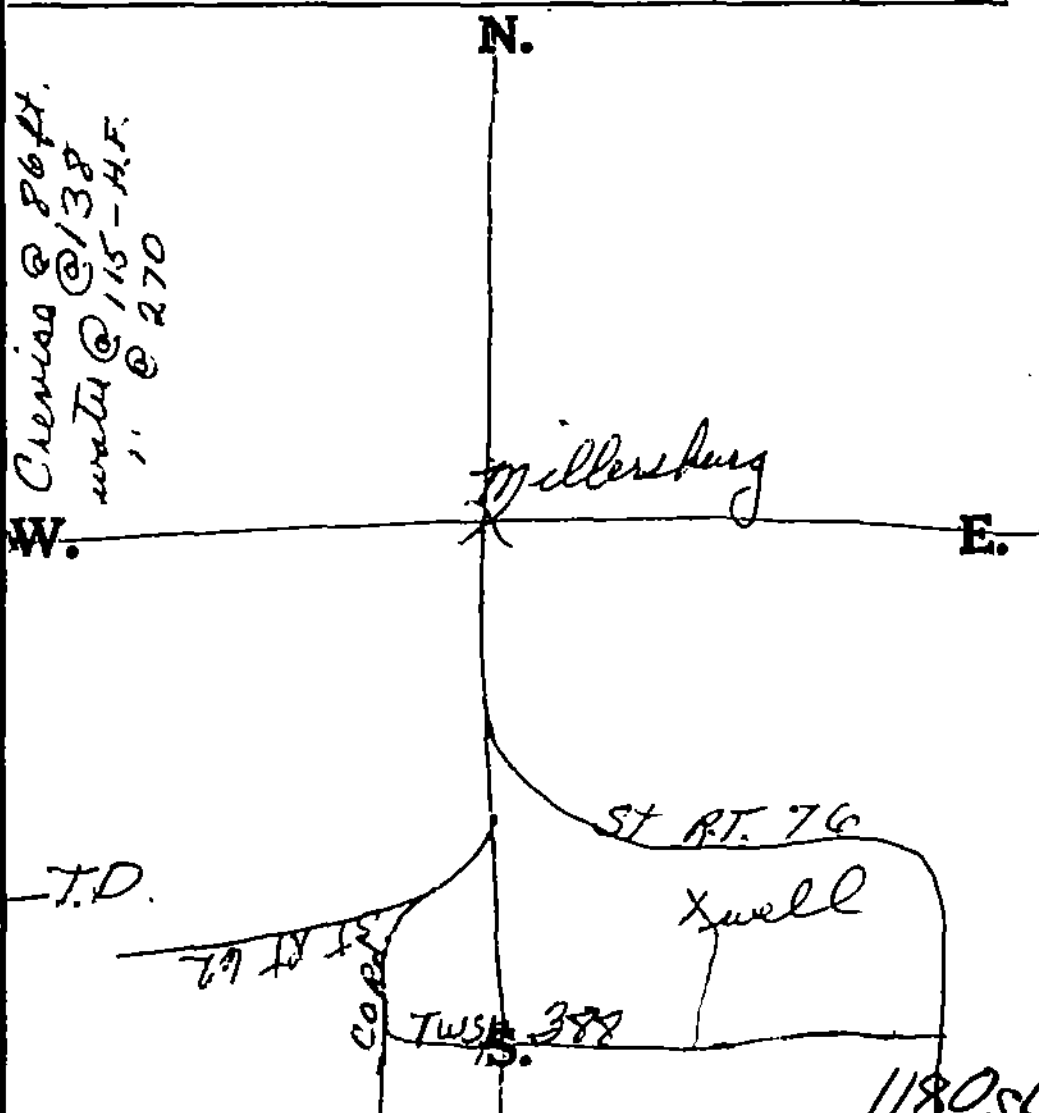

Drilling Firm Morany Dely Co.
Address Box 142-A Holmerville Ohio

Date 6/11/71
Signed Lewis Morany

*If additional space is needed to complete well log, use next consecutive numbered form.

12