

WELL LOG AND DRILLING REPORT

ORIGINAL

NO CARBON PAPER
NECESSARY—
SELF-TRANSCRIBING

State of Ohio
DEPARTMENT OF NATURAL RESOURCES
Division of Water
65 S. Front St., Rm. 815 Phone (614) 469-2646
Columbus, Ohio 43215

455116

County Richland Township Madison Section of Township 9

Owner Jacob M. Etywiler Address 1214 Carine Rd.

Location of property 2nd House on Left on Schulties Dr.

CONSTRUCTION DETAILS

Casing diameter 4 1/4 Length of casing 152
Type of screen None Length of screen None
Type of pump Submersible
Capacity of pump 10 gal min
Depth of pump setting 55 ft.
Date of completion Nov. 1-77

BAILING OR PUMPING TEST
(Specify one by circling)


Test Rate 1.4 G.P.M. Duration of test 4 hrs.
Drawdown 33 ft. Date 10-25-77
Static level-depth to water 13 ft.
Quality (clear) cloudy, taste, odor)
Pump installed by Ned. Wagner

WELL LOG*

Formations Sandstone, shale, limestone, gravel and clay	From	To
<u>Yellow Clay</u>	<u>0 Feet</u>	<u>22 Ft.</u>
<u>Yellow Clay + Gravel</u>	<u>22</u>	<u>33</u>
<u>Sand Brown</u>	<u>33</u>	<u>55</u>
<u>Gray Clay + Gravel</u>	<u>55</u>	<u>57</u>
<u>Brown & Sand</u>	<u>57</u>	<u>116</u>
<u>Gray Clay + Sand</u>	<u>116</u>	<u>128</u>
<u>Sand Gray</u>	<u>128</u>	<u>142</u>
<u>Sand Gray + Gravel</u>	<u>142</u>	<u>147</u>
<u>Gravel</u>	<u>147</u>	<u>152</u>

SKETCH SHOWING LOCATION

Locate in reference to numbered
State Highways, St. Intersections, County roads, etc.

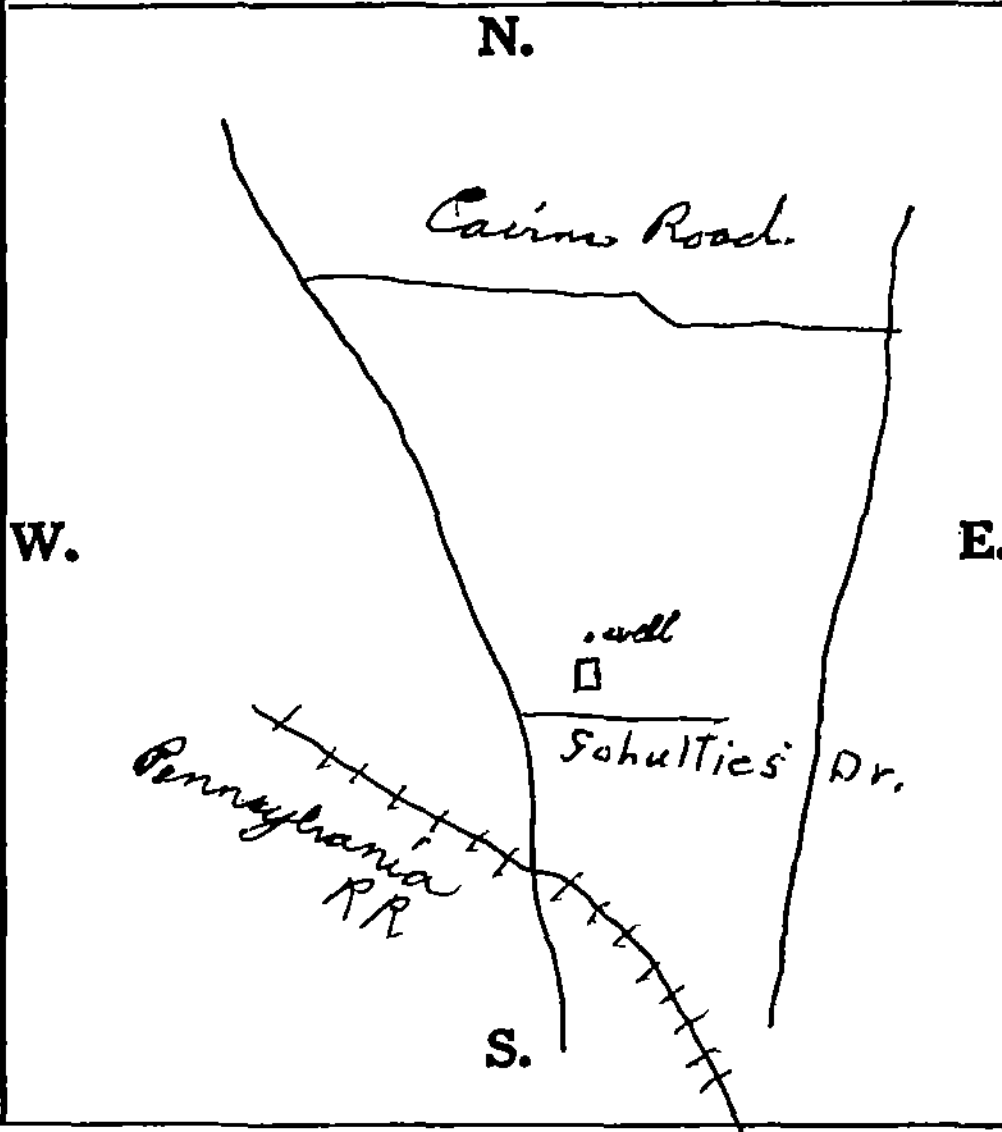

Drilling Firm

H M. Likes

Date

12-2-77