

WELL LOG AND DRILLING REPORT

ORIGINAL

NO CARBON PAPER
NECESSARY -
SELF-TRANSCRIBING

State of Ohio
DEPARTMENT OF NATURAL RESOURCES
Division of Geological Survey
Fountain Square
Columbus, Ohio 43224 Phone (614) 466-5344

471864

COUNTY Fairfield TOWNSHIP WALNUT SECTION OF TOWNSHIP OR LOT NUMBER Section 4.
OWNER John Singleton (SR.) ADDRESS Box 383 Millersport OH 43046
LOCATION OF PROPERTY Millersport Road

CONSTRUCTION DETAILS

Casing diameter 5 inch Length of casing 155 ft
Type of screen Peregrine Length of screen 2 ft
Type of pump Submersible
Capacity of pump 1/2 H.P.
Depth of pump setting 140 ft
Date of completion OCT 28, 1975

BAILING OR PUMPING TEST (specify one by circling)


Test rate 20 gpm Duration of test 1 1/2 hrs
Drawdown 20 ft Date OCT 29, 1975
Static level (depth to water) 80 ft
Quality (clear, cloudy, taste, odor) Clear.
Pump installed by LANCASTER Well Service

WELL LOG*

Formations: sandstone, shale, limestone, gravel, clay	From	To
TOP SOIL	0 ft	5 ft
YELLOW CLAY	5	15
BLUE CLAY & GRAVEL	15	30
BLUE CLAY	30	60
GRAY SAND & GRAVEL	60	75
BLUE CLAY & GRAVEL	75	125
SAND & GRAVEL BLUE MUD	125	135
BLUE MUD & GRAVEL	135	150
GRAVEL	150	155
WATER	155	

SKETCH SHOWING LOCATION

Locate in reference to numbered
state highways, street intersections, county roads, etc.

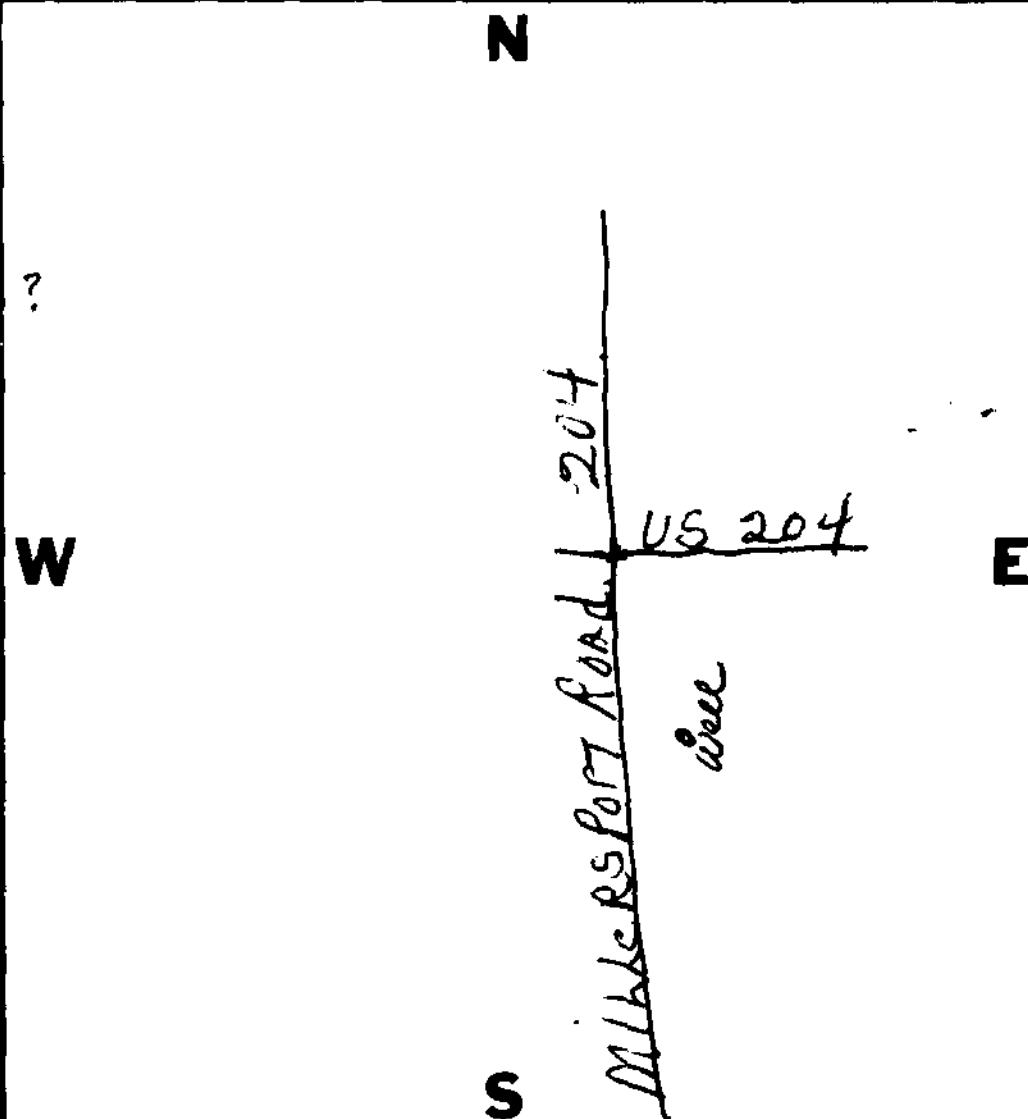

DRILLING FIRM Lancaster Well Service
ADDRESS Route 2 Carroll, Ohio

DATE OCT 29, 1975
SIGNED John Casey

*If additional space is needed to complete well log, use next consecutive numbered form.

