

WELL LOG AND DRILLING REPORT

ORIGINAL

NO CARBON PAPER
NECESSARY -
SELF-TRANSCRIBING

State of Ohio
DEPARTMENT OF NATURAL RESOURCES
Division of Geological Survey
Fountain Square
Columbus, Ohio 43224

497513

Phone (614) 466-5344

COUNTY HAMILTON TOWNSHIP CINCINNATI SECTION OF TOWNSHIP
OR LOT NUMBER _____

OWNER MIAMI MARGARINE COMPANY ADDRESS 5226 VINE STREET

LOCATION OF PROPERTY WEST OF I 75, EAST OF VINE STREET

CONSTRUCTION DETAILS

Casing diameter 20" x 12" Length of casing 99'
Type of screen 12" ID WIRE WOUND Length of screen 25'
Type of pump LINESHAFT TURBINE DEEP WELL
Capacity of pump 450
Depth of pump setting 101'
Date of completion 1-5-77

BAILING OR PUMPING TEST

(specify one by circling)


Test rate 407 gpm Duration of test 3 hrs
Drawdown 13 ft Date 1-5-77
Static level (depth to water) 59' ft
Quality (clear, cloudy, taste, odor) CLEAR
Pump installed by DIEHL PUMP COMPANY, DIV.

WELL LOG*

Formations: sandstone, shale, limestone, gravel, clay	From	To
TOP SOIL	0 ft	2 ft
BROWN CLAY	2	42
SANDY BLUE CLAY	42'	60
MUDDY BROWN SAND	60'	85'
FINE GRAY SAND	85'	124'
NOTE - THIS WELL WAS TERMINATED AT 124' BELOW GRADE DUE TO EXTREMELY FINE SAND BELOW THIS DEPTH. MANY WELLS IN THIS AREA EXCEED 180' DEPTH		

SKETCH SHOWING LOCATION

Locate in reference to numbered
state highways, street intersections, county roads, etc.

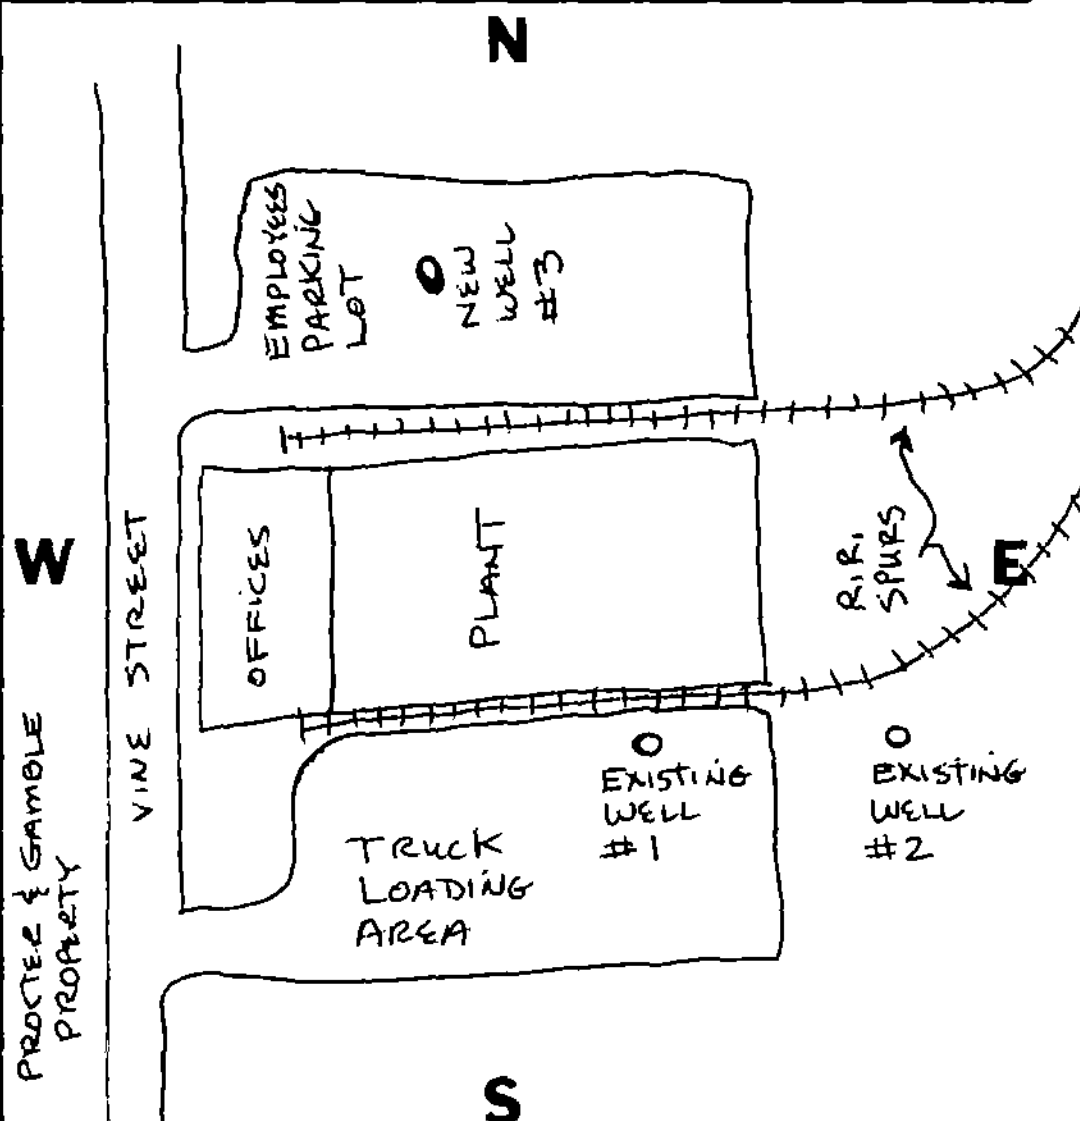

DIEHL PUMP CO, DIVISION
DRILLING FIRM MOODY'S OF DAYTON INC.
P.O. Box 21276
ADDRESS LOUISVILLE, KY 40221

DATE 1-19-77
SIGNED [Signature]

*If additional space is needed to complete well log, use next consecutive numbered form.