

WELL LOG AND DRILLING REPORT

ORIGINAL

NO CARBON PAPER
NECESSARY -
SELF-TRANSCRIBING

State of Ohio
DEPARTMENT OF NATURAL RESOURCES
Division of Water
Fountain Square
Columbus, Ohio 43224

498873

COUNTY Lawrence TOWNSHIP Windsor SECTION OF TOWNSHIP 1 OK
OWNER Earnest Sandman ADDRESS Scottown
LOCATION OF PROPERTY On township 80 rd. 1/4 mile east of rt. rd 37 3 miles north of Scottown

CONSTRUCTION DETAILS

BAILING OR PUMPING TEST
(specify one by circling)

Casing diameter 5 5/8" Length of casing 21 ft. Test rate 8 gpm Duration of test 1 hrs
Type of screen NONE Length of screen N/A Drawdown 100 ft Date 22 May 77
Type of pump None Static level (depth to water) _____ ft
Capacity of pump N/A Quality (clear, cloudy, taste, odor) good water
Depth of pump setting N/A but very little.
Date of completion 22 May 77 Pump installed by _____

WELL LOG*

SKETCH SHOWING LOCATION

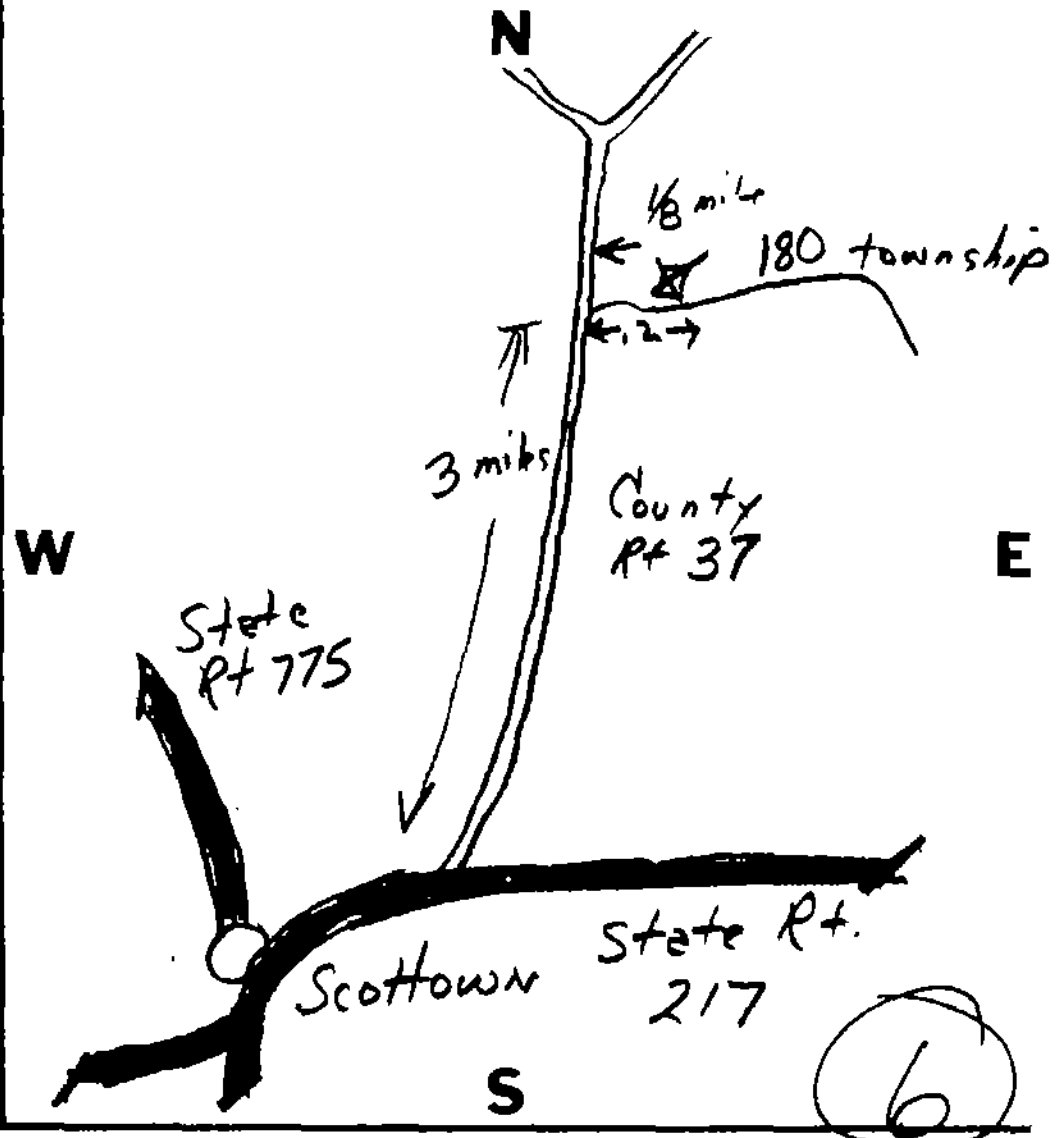
Formations: sandstone, shale,
limestone, gravel, clay

From

To

Locate in reference to numbered
state highways, street intersections, county roads, etc.

soft yellow sandstone	0 ft	15 ft
gray sandstone	15	21
red shale	21	28
blue shale	28	60
gray shale	60	75
red shale	75	85
gray shale	85	100

very little water

DRILLING FIRM Borders Water Well Serv.
ADDRESS Rt 1 Box 10A Ironton OH
45638

DATE 6 Feb 78
SIGNED John Borders Jr

*If additional space is needed to complete well log, use next consecutive numbered form.