

NO CARBON PAPER
NECESSARY -
SELF-TRANSCRIBING

State of Ohio
DEPARTMENT OF NATURAL RESOURCES
Division of Water
Fountain Square
Columbus, Ohio 43224

537206

COUNTY Shelby TOWNSHIP Salem SECTION OF TOWNSHIP _____
OWNER Donald Davis ADDRESS 18680 RT 47, Sidney, OH
LOCATION OF PROPERTY Lot 113 Country Meadows, Sidney, OH

CONSTRUCTION DETAILS

BAILING OR PUMPING TEST
(specify one by circling)

Casing diameter 6" OD Length of casing 183 ft. Test rate 15 gpm Duration of test 3 hrs
Type of screen _____ Length of screen _____ Drawdown 9 ft Date Aug 20, 1979
Type of pump _____ Static level (depth to water) 56 ft
Capacity of pump _____ Quality (clear, cloudy, taste, odor) clear
Depth of pump setting _____ Pump installed by _____
Date of completion Aug 21, 1979

WELL LOG*

SKETCH SHOWING LOCATION


Formations: sandstone, shale,
limestone, gravel, clay

From

To

Locate in reference to numbered
state highways, street intersections, county roads, etc.

Top soil	0 ft	17 ft
Gray sandy clay	17	20
Hard pan (Br)	20	22
Brown sandy clay	22	53
Gray sandy clay	53	62
Br. " "	62	75
Sand (muddy)	75	76
Gray sandy clay	76	105
Brown " "	105	118
Quick sand	118	139
Gray clay	139	154
Quick sand	154	160
Red clay	160	171
Sand muddy	171	173
Hard pan	173	178
Br. clay	178	181
Limestone (water)	181	188

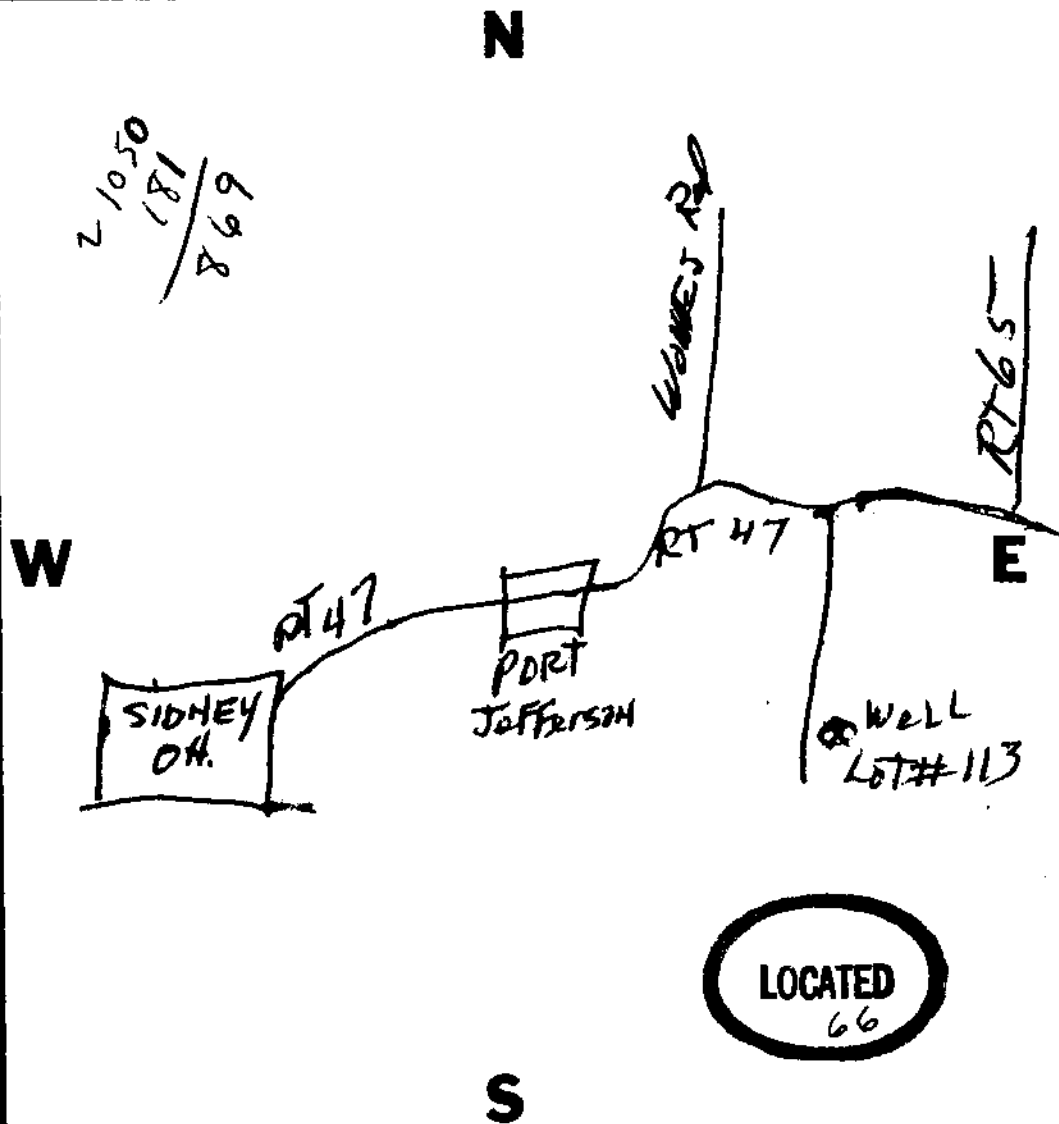

DRILLING FIRM

Miami Well Service

DATE

Aug 23, 1979

ADDRESS

1635 So. Walnut, Sidney, OH

SIGNED

William L. Anderson

South of 47

*If additional space is needed to complete well log, use next consecutive numbered form.