

WELL LOG AND DRILLING REPORT

NO CARBON PAPER
NECESSARY -
SELF-TRANSCRIBING

State of Ohio
DEPARTMENT OF NATURAL RESOURCES
Division of Water
Fountain Square
Columbus, Ohio 43224

594054

COUNTY Fairfield TOWNSHIP Walnut SECTION OF TOWNSHIP 34
OWNER Village of Pleasantville ADDRESS Pleasantville, Ohio 43148
LOCATION OF PROPERTY Pleasantville Water works Pleasantville Rd

CONSTRUCTION DETAILS

BAILING OR PUMPING TEST

(specify one by circling)

Casing diameter * 8" I.D. Length of casing 63' 6"
Type of screen none Length of screen _____
Type of pump Submersible Turbin
Capacity of pump 175 G.P.M.
Depth of pump setting 84 FT.
Date of completion April 22, 1982

Test rate 150 gpm Duration of test 24 hrs
Drawdown 5' 6" ft Date 4/6/82
Static level (depth to water) 25 ft
Quality (clear, cloudy, taste, odor) Clear
Pump installed by McBride

WELL LOG*

SKETCH SHOWING LOCATION

Formations: sandstone, shale,
limestone, gravel, clay


From

To

Locate in reference to numbered
state highways, street intersections, county roads, etc.

Formations: sandstone, shale, limestone, gravel, clay	From	To
Clay & gravel	0 ft	44 ft
Cemented gravel	44	47
Gray clay	47	55
Yellow clay & water	55	57
Gray shale	57	100

Water at 85 ft.

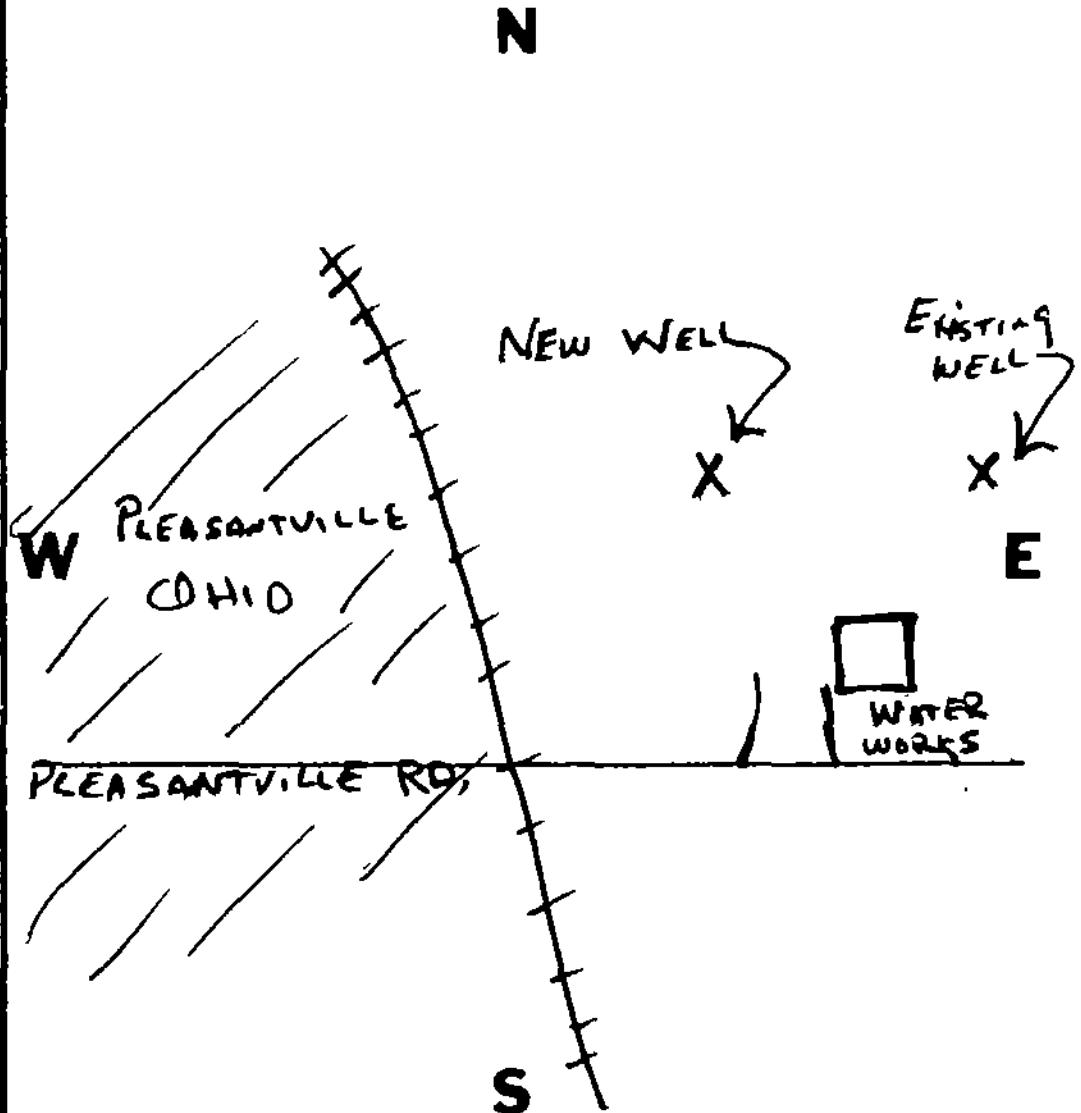

DRILLING FIRM McBride Drilling Company

DATE April 23, 1982

ADDRESS Lancaster, Ohio 43130

SIGNED Sam McBride

*If additional space is needed to complete well log, use next consecutive numbered form.

ORIGINAL COPY - ODNR, DIVISION OF WATER, FOUNTAIN SQ., COLS., OHIO 43224