

WELL LOG AND DRILLING REPORT

NO CARBON PAPER
NECESSARY—
SELF-TRANSCRIBING

State of Ohio
DEPARTMENT OF NATURAL RESOURCES
Division of Water
Fountain Square
Columbus, Ohio 43224

596242

COUNTY STARK TOWNSHIP Osnaburg SECTION OF TOWNSHIP _____
OWNER Smith, Randy ADDRESS 4110 Waynesburg Dr SE
LOCATION OF PROPERTY Canton, Ohio

CONSTRUCTION DETAILS

Casing diameter 5" Length of casing 208
Type of screen — Length of screen —
Type of pump 3/4 Hp webTrol
Capacity of pump 5 gpm
Depth of pump setting 357
Date of completion Oct 11, 1982

BAILING OR PUMPING TEST

(specify one by circling)


Test rate 3 gpm Duration of test 2 hrs
Drawdown 100 ft Date Oct 13
Static level (depth to water) 257 ft
Quality (clear, cloudy, taste, odor) slightly cloudy
no odor, no salt 7.2 pH 1 gr hard
Pump installed by Culp Drilling

WELL LOG*

Formations: sandstone, shale, limestone, gravel, clay	From	To
	0 ft	ft
Top	0	7
sandstone	7	35
shale	35	115
coal	115	118
Fine clay	118	127
sandy shale	127	193
sandrock	193	196
sandy shale	196	198
limestone	198	207
coal	207	245
white shale & lime	245	247
blue shale	247	275
gray sandy shale	275	337
sandrock	337	370

SKETCH SHOWING LOCATION

Locate in reference to numbered
state highways, street intersections, county roads, etc.

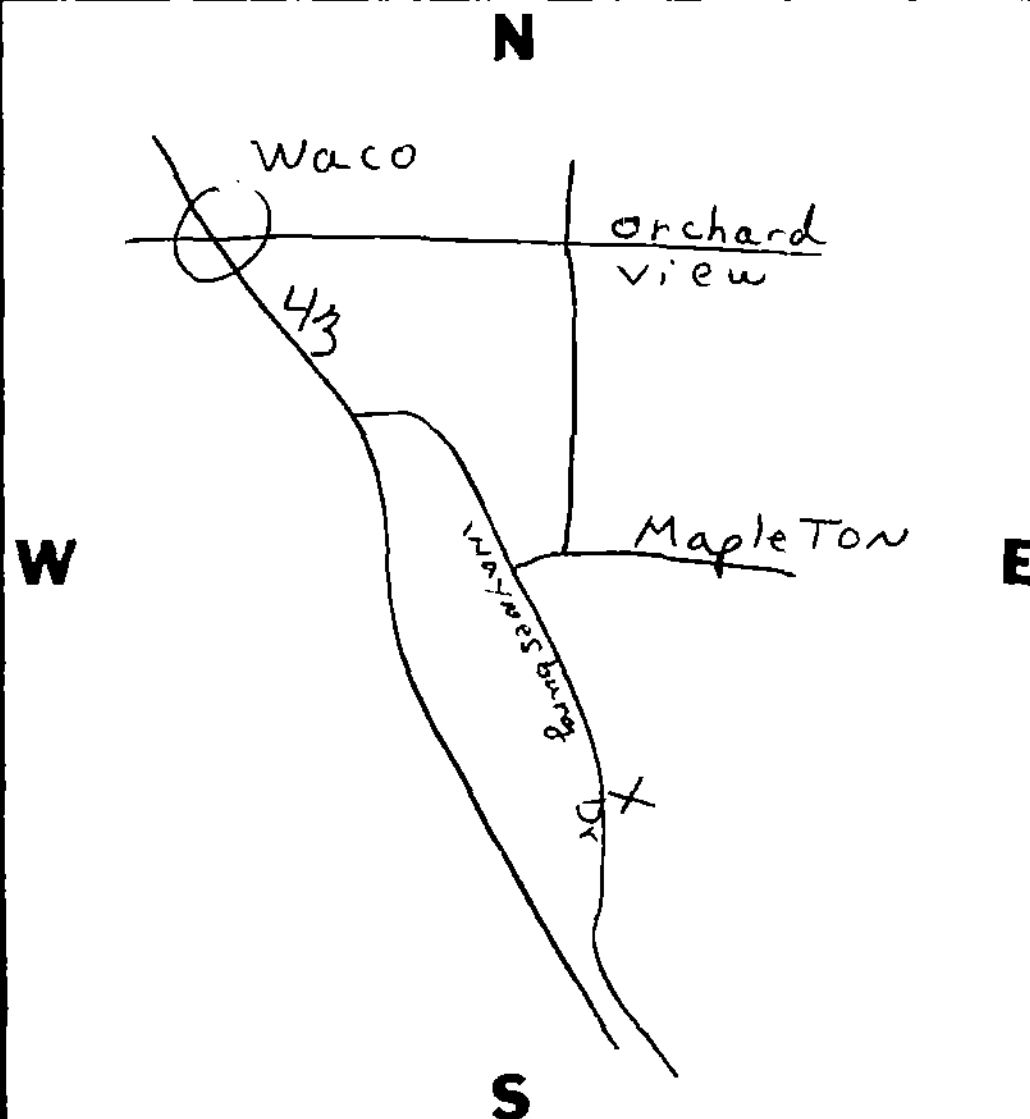

DRILLING FIRM AB Culp Drilling
ADDRESS 6906 ATI Blvd
Fountain Square, Ohio

DATE Oct 19, 1982
SIGNED David Culp

*If additional space is needed to complete well log, use next consecutive numbered form.

ORIGINAL COPY - ODNR, DIVISION OF WATER, FOUNTAIN SQ., COLS., OHIO 43224