

WELL LOG AND DRILLING REPORT

NO CARBON PAPER
NECESSARY -
SELF-TRANSCRIBING

State of Ohio
DEPARTMENT OF NATURAL RESOURCES
Division of Water
Fountain Square
Columbus, Ohio 43224

605573

COUNTY Sandusky TOWNSHIP Ballville SECTION OF TOWNSHIP _____
OWNER Paul & Homebuilders ADDRESS 835 East CR 181 Fremont, OH
LOCATION OF PROPERTY 701 East Cole Rd.

CONSTRUCTION DETAILS

Casing diameter 5" Length of casing 81 ft.
Type of screen _____ Length of screen _____
Type of pump _____
Capacity of pump _____
Depth of pump setting _____
Date of completion _____

BAILING OR PUMPING TEST (specify one by circling)


Test rate 13 gpm Duration of test 1 1/2 hrs
Drawdown 12 ft Date 9-1-87
Static level (depth to water) 40 ft
Quality (clear, cloudy, taste, odor) clear
Pump installed by _____

WELL LOG*

Formations: sandstone, shale, limestone, gravel, clay	From	To
<u>yellow clay</u>	0 ft	12 ft
<u>soft grey clay</u>	12	19
<u>sand & gravel</u>	19	28
<u>clay</u>	28	35
<u>sand & gravel</u>	35	45
<u>clay</u>	45	73
<u>broken limestone</u>	73	78
<u>limestone</u>	78	127

SKETCH SHOWING LOCATION

Locate in reference to numbered
state highways, street intersections, county roads, etc.

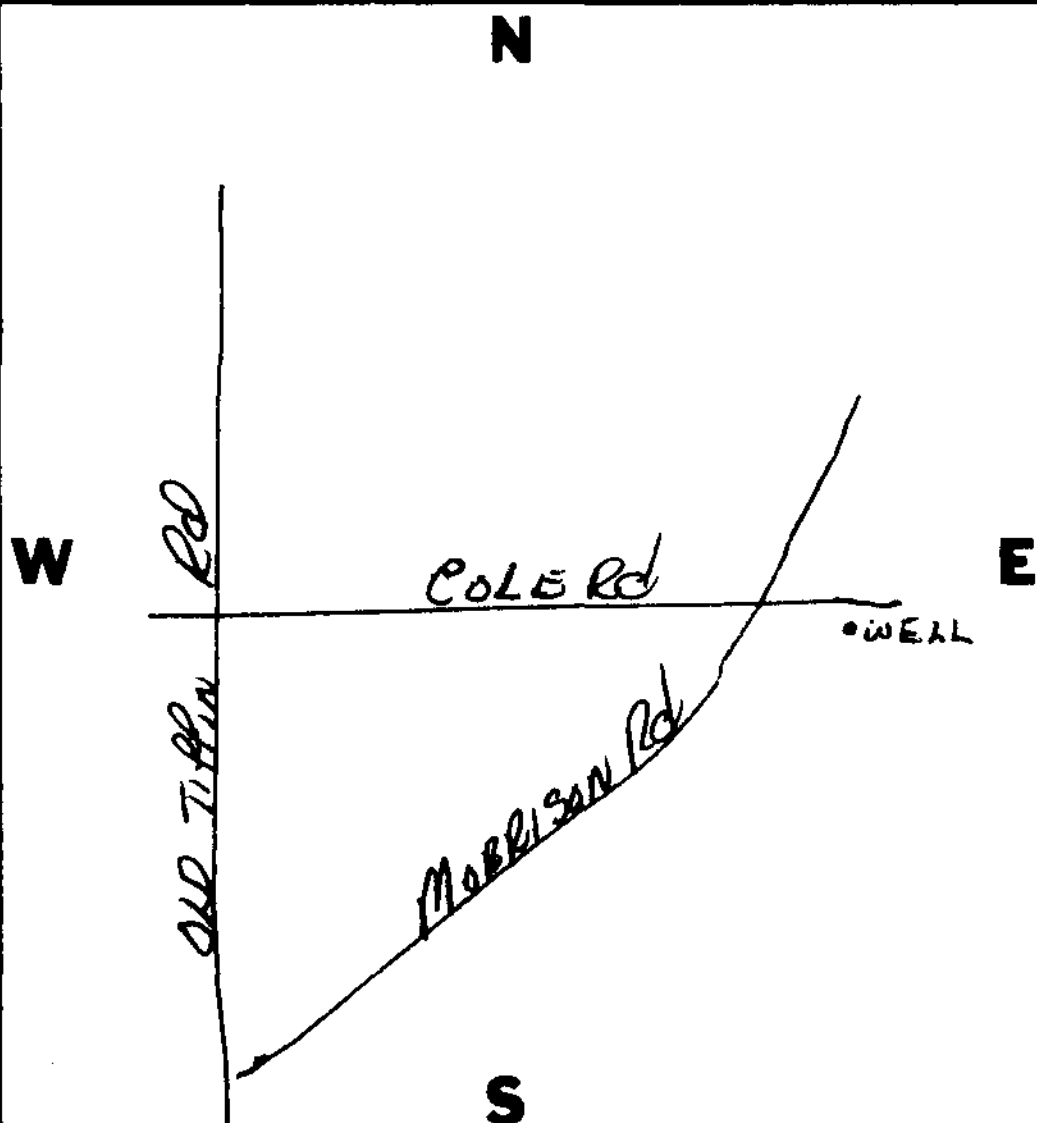

DRILLING FIRM Paul Green Well Drilling
ADDRESS Maraca, Ohio

DATE Sept. 1, 1987
SIGNED Paul F. Hoffmann

*If additional space is needed to complete well log, use next consecutive numbered form.

ORIGINAL COPY - ODNR, DIVISION OF WATER, FOUNTAIN SQ., COLS., OHIO 43224