

WELL LOG AND DRILLING REPORT

NO CARBON PAPER
NECESSARY -
SELF-TRANSCRIBING

State of Ohio
DEPARTMENT OF NATURAL RESOURCES
Division of Water
Fountain Square
Columbus, Ohio 43224

623012

COUNTY Ottawa TOWNSHIP Harris SECTION OF TOWNSHIP 11

OWNER Brush Wellman Inc. ADDRESS South River Road, Clmore, Ohio 43416

LOCATION OF PROPERTY 1/2 Mile South of Rt. 105 on East side of Rt. 590

CONSTRUCTION DETAILS

Casing diameter 10" Length of casing 80'
Type of screen None Length of screen 0
Type of pump No pump
Capacity of pump 0
Depth of pump setting 0
Date of completion Pump not installed

BAILING OR PUMPING TEST

(specify one by circling)

Test rate 100 gpm Duration of test 24 hrs
Drawdown 177 ft Date 9-29-& 30-83
Static level (depth to water) 40 ft
Quality (clear, cloudy, taste, odor) Clear - taste ok.
Slight odor
Pump installed by Pump not installed


WELL LOG*

Formations: sandstone, shale, limestone, gravel, clay	From	To
Yellow Clay	0 ft	13 ft
Gray Clay	13'	23'
Hard Gray Limestone	23'	30'
Light & Dark Gray lime XXXXXX	30'	53'
Gray & Brown lime	53'	145'
Brown lime	145'	174'
Gray lime	174'	255'
Light gray lime	255'	290'
Light gray & Brown lime	290'	400'

WELL WAS TREATED WITH 1000 GALLONS MURATIC
ACID - 10" CASING GROUTED TO SURFACE. . .

SKETCH SHOWING LOCATION

Locate in reference to numbered
state highways, street intersections, county roads, etc.

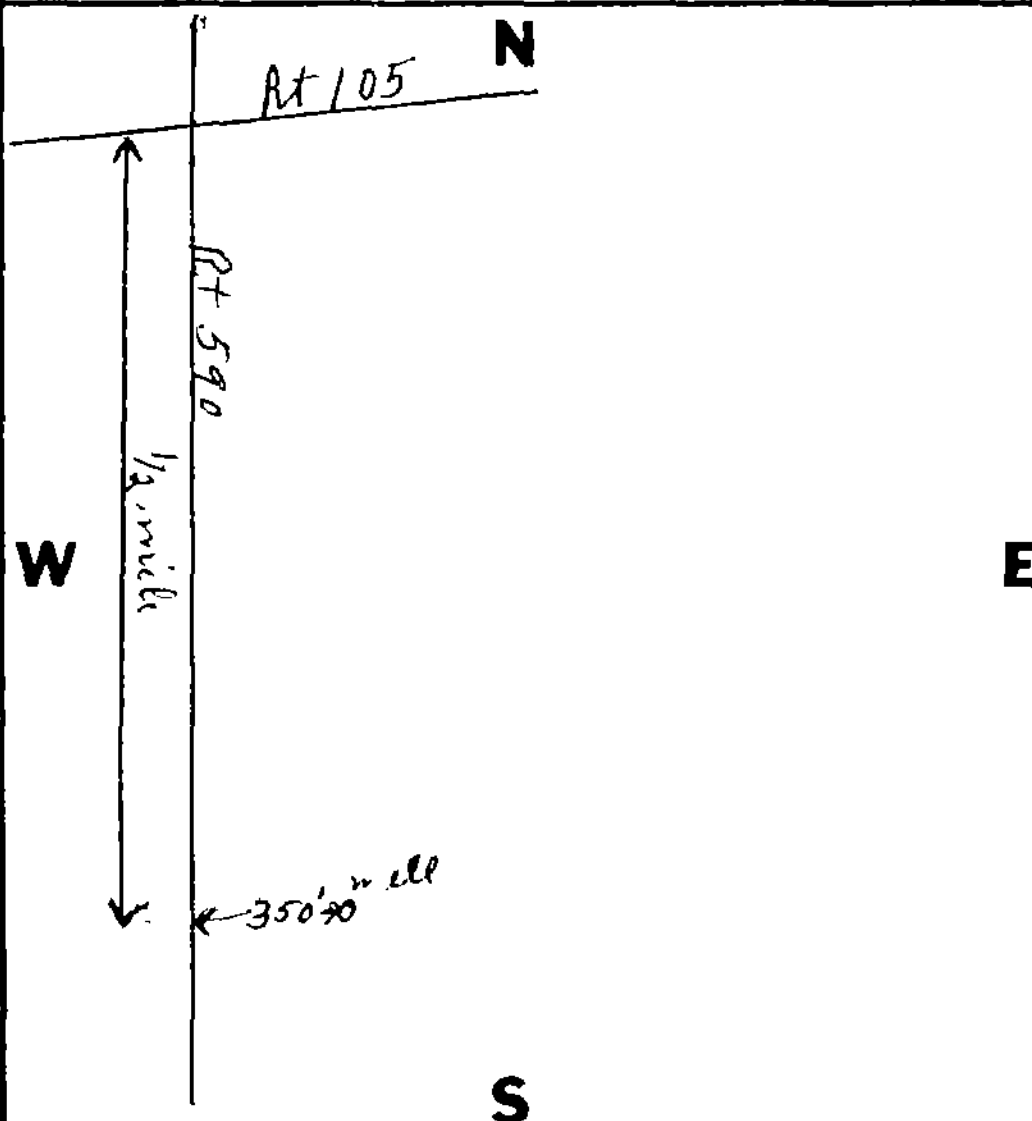

DRILLING FIRM Dunbar Drilling Inc.

DATE 10-12-83

ADDRESS 307 Broadway, Swanton, Ohio 43558

SIGNED Mary R. Stark
Mary R. Stark, President

*If additional space is needed to complete well log, use next consecutive numbered form.

ORIGINAL COPY - ODNR, DIVISION OF WATER, FOUNTAIN SQ., COLS., OHIO 43224