

WELL LOG AND DRILLING REPORT

NO CARBON PAPER
NECESSARY -
SELF-TRANSCRIBING

State of Ohio
DEPARTMENT OF NATURAL RESOURCES
Division of Water
Fountain Square
Columbus, Ohio 43224

623290

COUNTY Wood TOWNSHIP MIDDLETON SECTION OF TOWNSHIP #25
OWNER J.J. HEINZ CO. ADDRESS 13737 MIDDLETON HEIGHTS
LOCATION OF PROPERTY HEINZ CO. APPROX. 3/4 mi west of State Rr. 25 on State R 582 S side of Rd.

CONSTRUCTION DETAILS

Casing diameter 8" Length of casing 64'
Type of screen _____ Length of screen _____
Type of pump _____
Capacity of pump _____
Depth of pump setting _____
Date of completion September 7, 1988

BAILING OR PUMPING TEST (specify one by circling)


Test rate 170 gpm Duration of test 2 hrs
Drawdown 192' ft Date _____
Static level (depth to water) 18' ft
Quality (clear, cloudy, taste, odor) clear
Pump installed by _____

WELL LOG*

Formations: sandstone, shale, limestone, gravel, clay	From	To
TOP SOIL	0 ft	1 ft
YELLOW CLAY	1	9
STONY GRAY Clay	9	24
HARDPAN	24	56½
VERY SOFT BROKEN LGT. BROWN	LS 56½	58½
STREAKS OF BROWN & GRAY LS	58½	62
GRAY LIME STONE	62	90
GRAY LIME STONE W/STREAKS OF LIGHT GRAY SAND LIME STONE	90	100
LIGHT GRAY TO WHITE SANDY LIMESTONE W/STREAKS OF GRAY	100	110
GRAY LIME STONE	110	120
LIGHT GRAY TO WHITE SANDY LS	120	220
SANDY WHITE LIMESTONE W/STREAKS OF GRAY LIME STONE	220	275
GRAY LIME STONE	275	288
LIGHT GRAY TO WHITE SANDY LIME STONE	288	290
BROWN TO LIGHT BRN LIMESTONE	290	293
DARK BLACKISH GRAY LIMESTONE	293	298
GREEN SHALE	298	300

SKETCH SHOWING LOCATION

Locate in reference to numbered
state highways, street intersections, county roads, etc.

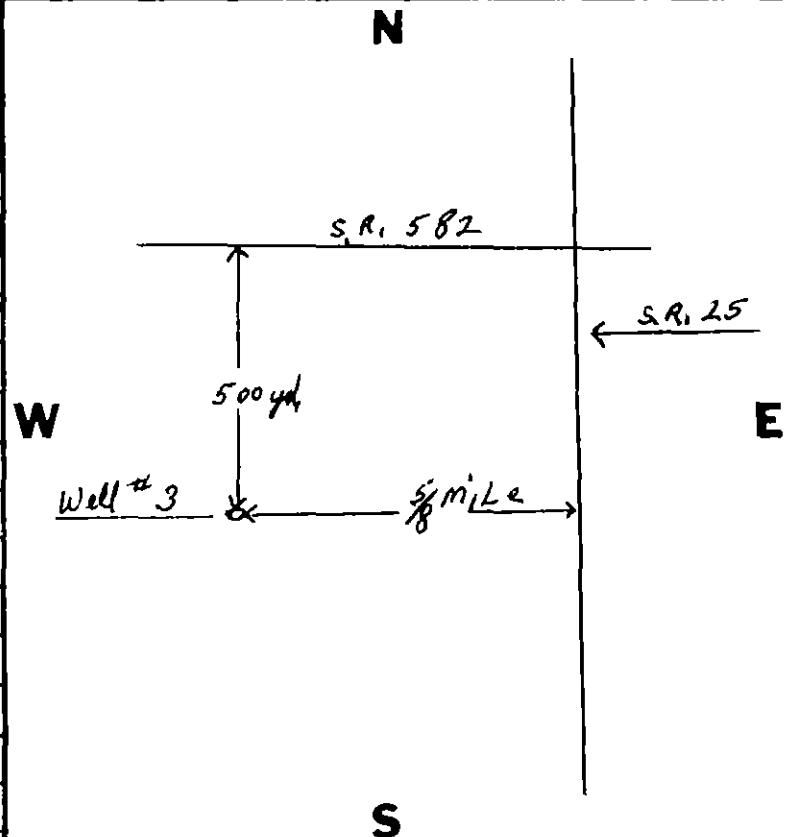

DRILLING FIRM DUNBAR-STARK DRILLING, INC., INC. DATE _____

ADDRESS 2997 TREAT HWY., ADRIAN, MI 49221

SIGNED _____

*If additional space is needed to complete well log, use next consecutive numbered form.

ORIGINAL COPY - ODNR, DIVISION OF WATER, FOUNTAIN SQ., COLS., OHIO 43224