

WELL LOG AND DRILLING REPORT

NO CARBON PAPER
NECESSARY -
SELF-TRANSCRIBING

State of Ohio
DEPARTMENT OF NATURAL RESOURCES
Division of Water
Fountain Square
Columbus, Ohio 43224

623472

COUNTY Summit TOWNSHIP Coventry SECTION OF TOWNSHIP _____
OWNER Henry Wilson ADDRESS 3006 Manchester Rd
Akron OH 44319
LOCATION OF PROPERTY _____

CONSTRUCTION DETAILS

Casing diameter 5" Length of casing 25'
Type of screen - Length of screen -
Type of pump Submersible
Capacity of pump 7 gpm
Depth of pump setting 45
Date of completion 4-26-86

BAILING OR PUMPING TEST (Specify one by circling)


Test rate 9 gpm Duration of test 2 hrs
Drawdown 5 ft Date _____
Static level (depth to water) 20 ft
Quality (clear, cloudy, taste, odor) _____
Pump installed by Frantz-Dawson Co. Inc.

WELL LOG*

Formations: sandstone, shale, limestone, gravel, clay	From	To
Top Soil/Broken Rock	0 ft	2 ft
Brack Sand Rock	2	10
Brown Sand Rock	10	25
Brown Sand Rock	25	45
Grey Shale	45	50
Brown Sand Rock	50	56

SKETCH SHOWING LOCATION

Locate in reference to numbered
state highways, street intersections, county roads, etc.

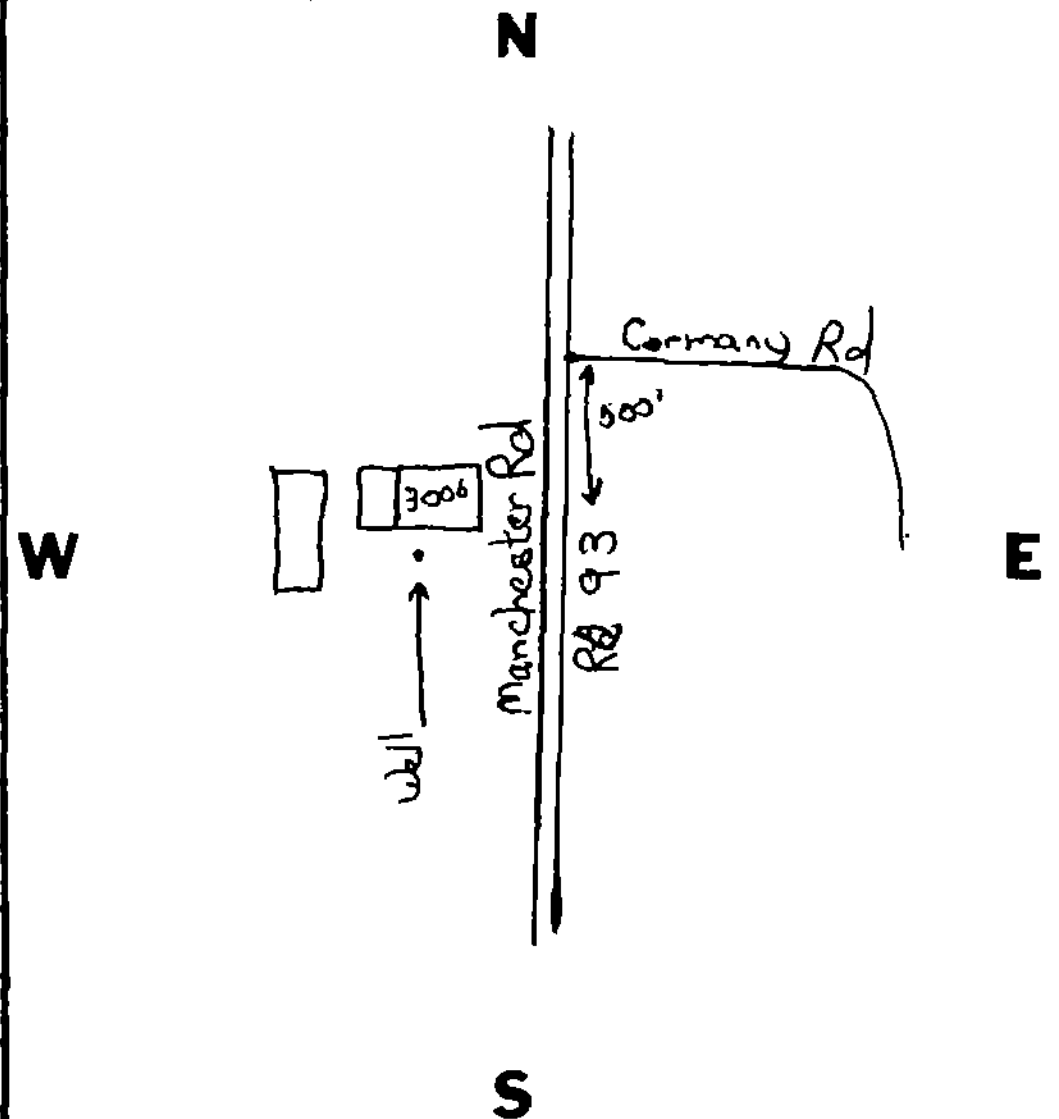

DRILLING FIRM Frantz & Dawson Co. Inc.

DATE 4-28-86